

## Recall Summary – European Toys

### EU Safety Gate Alerts (Feb 2024)

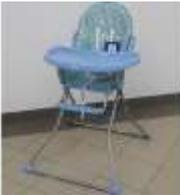
Alert No.	Notifying Country	Product	Product Photo	Hazard / Risk	Measures Adopted
A11/00018/24	Malta	<b>Soft toy</b>  (Country of Origin: <b>Unknown</b> )		<b>Choking</b> The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. A small child may put the filling material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
A11/00020/24	France	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The fibrous stuffing material of the toy is easily accessible due to the weakness of the seam at the back of the neck. A small child may put the filling material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive, nor with European standard EN 71-1.	Withdrawal of the product from the market
A12/00181/24	Cyprus	<b>Set of acrylic paints</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> There is an excessive migration of aluminium from the paints, in particular the blue paint; it is too high (measured value up to 4,834 mg/kg). Aluminium is toxic to children if ingested. The product does not comply with the requirements of the Toy Safety Directive nor with European standard EN 71-3.	Withdrawal of the product from the market
A12/00206/24	Sweden	<b>Toy slime</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The migration of boron from the toy slime is too high (measured value up to 1,300 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Removal of this product listing by the online marketplace

A12/00209/24	Germany	<b>Nesting toy dolls</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has small parts (the otter figurine) and part of the toy can also be disassembled (the rabbit figurine) into small parts. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace
A12/00210/24	Germany	<b>Nesting toy dolls</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has small parts (the smallest bear figurine). A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace
A12/00223/24	Poland	<b>Plastic swing</b>  (Country of Origin: <b>China</b> )		<b>Entrapment, Injuries, Strangulation</b> The product has accessible openings and holes, in which children can become trapped or suffer injuries. The swing seat is attached to the rope by knots, which may loosen and cause a child to fall off the swing. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-8.	Warning consumers of the risks
A12/00224/24	Poland	<b>Toy scooter</b>  (Country of Origin: <b>China</b> )		<b>Injuries</b> The front wheels are too small and could get stuck in holes in the ground. This could cause the child to lose balance and fall off, leading to injuries. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
A12/00225/24	Poland	<b>Magnetic toy</b>  (Country of Origin: <b>China</b> )		<b>Choking, Injuries</b> The magnets have a high magnetic flux; they can easily detach from the toy. If a child swallows them, they could attract one another, causing intestinal blockage or perforation. The product does not comply with the requirements of the Toy Safety Directive and the European standard EN 71-1.	Withdrawal of the product from the market

A12/00226/24	Poland	<b>Wooden swing</b>  (Country of Origin: <b>China</b> )		<b>Injuries, Strangulation</b> The product has accessible openings and holes, in which children can become trapped or suffer injuries. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-8.	Withdrawal of the product from the market
A12/00229/24	France	<b>Finger-paint inkpad</b>  (Country of Origin: <b>China</b> )		<b>Chemical, Choking</b> The product has excessive concentrations of methylisothiazolinone (MI) and methylchloroisothiazolinone (MCI) (measured values up to 2.7 mg/kg and 2.4 mg/kg, respectively). MI and MCI are strong sensitizers and can provoke allergic contact dermatitis in sensitized persons. Moreover, the foam of the ink pad tears easily; a small child may put the foam in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-9.	Removal of this product listing by the online marketplace
A12/00241/24	Lithuania	<b>Toy airplanes</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The airplanes have small parts. Small children may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
A12/00244/24	Czechia	<b>Drill toy</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 83.9% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Withdrawal of the product from the market

A12/00245/24	Czechia	<b>Toy car</b>  (Country of Origin: <b>China</b> )		<b>Environment</b>  The solders in the product have an excessive concentration of lead (measured value up to 72% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Withdrawal of the product from the market
A12/00246/24	Czechia	<b>Toy drill</b>  (Country of Origin: <b>China</b> )		<b>Environment</b>  The solders in the product have an excessive concentration of lead (measured value up to 69.9% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Recall of the product from end users
A12/00250/24	France	<b>Finger paint</b>  (Country of Origin: <b>Türkiye</b> )		<b>Chemical</b>  The product contains methylisothiazolinone (MI) (measured value up to 0.005%), which is forbidden in finger paints. Dermal contact with MI containing products can provoke allergic contact dermatitis in sensitized persons. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-9.	Removal of this product listing by the online marketplace
A12/00261/24	France	<b>Toy car</b>  (Country of Origin: <b>China</b> )		<b>Choking</b>  The yellow light on the front of the car can easily detach. A small child could put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market

A12/00264/24	France	<b>Finger paint kit</b>  (Country of Origin: <b>China</b> )		<b>Chemical, Choking</b>  The product has excessive concentrations of methylisothiazolinone (MI) and methylchloroisothiazolinone (MCI) (measured values up to 0.25 mg/kg and 0.75 mg/kg respectively). MI and MCI are strong sensitizers and can provoke allergic contact dermatitis in sensitized persons. Moreover, the foam of the ink pads tears easily. A small child may put the foam in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-7.	Removal of this product listing by the online marketplace
A12/00266/24	Cyprus	<b>Squeaky toy</b>  (Country of Origin: <b>Cyprus</b> )		<b>Chemical</b>  The plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 23.7% by weight). Phthalates may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Fine
A12/00267/24	Lithuania	<b>Toy fishing set</b>  (Country of Origin: <b>China</b> )		<b>Choking</b>  The toy has small parts (rings, rod roulette and fishing rod hook). Small children may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
A12/00273/24	Hungary	<b>Baby travel cot</b>  (Country of Origin: <b>Poland</b> )		<b>Injuries</b>  The cot is not sufficiently stable and may easily overturn. A small child may consequently fall out of the cot and suffer injuries. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 716-1.	Withdrawal of the product from the market

A12/00274/24	Malta	<b>Soft toy</b>  (Country of Origin: <b>Unknown</b> )		<b>Choking</b>  A small part can easily detach (suction cup). As a consequence, a small child may put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
A12/00278/24	Hungary	<b>High chair</b>  (Country of Origin: <b>China</b> )		<b>Injuries</b>  The high chair is not sufficiently stable and can easily tip over sideways. A seated child may fall and suffer injuries. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 14988.	Recall of the product from end users
A12/00279/24	Hungary	<b>Baby walker</b>  (Country of Origin: <b>Unknown</b> )		<b>Injuries</b>  The strength of the baby walker is inadequate and there is no proper protection against falls on stairs. Consequently, the product can collapse or fall down a flight of stairs during use, leading to injuries. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 1273.	Recall of the product from end users
A12/00281/24	Czechia	<b>Electronic toy</b>  (Country of Origin: <b>China</b> )		<b>Environment</b>  The solders on the product's printed circuit board (PCB) have excessive concentrations of lead and cadmium (measured values up to 78% and 0.13% by weight, respectively). Lead poses a risk to the environment and cadmium bio accumulates and poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Ban on the marketing of the product and any accompanying measures

A12/00286/24	Germany	<b>Soother holder</b>  (Country of Origin: <b>Germany</b> )		<b>Choking</b> The wooden beads and the cord can break. This will release small parts which a small child can put in their mouth and choke on. The product does not comply with the requirements of the General Product Safety Directive nor with European standard EN12586.	Destruction of the product
A12/00287/24	Finland	<b>Puffer toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> Small parts (including wings and tail) can easily detach from the toy. Small children may put small parts in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Import rejected at border
A12/00289/24	Finland	<b>Surprise toy</b>  (Country of Origin: <b>China</b> )		<b>Injuries</b> The magnetic flux index of the magnet in the soother is too high. If a small child swallows more than one magnet, they can attract each other through the intestinal mucosa generating intestinal obstruction or breakage. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Import rejected at border
A12/00293/24	Germany	<b>Nesting dolls</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The dolls are too small. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace
A12/00313/24	The Netherlands	<b>Wooden baby toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The bell (a small part) inside the wooden baby toy can be damaged and fall through the bars of the cylinder. Small children may put the bell in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive.	Recall of the product from end users

A12/00314/24	Germany	<b>Soother holder</b>  (Country of Origin: <b>Germany</b> )		<b>Choking</b> The wooden beads can break apart, releasing small parts. A small child may put them in their mouth and choke. The product does not comply with the requirements of the General Product Safety Directive nor with European standard EN 12586.	Destruction of the product
A12/00315/24	Cyprus	<b>Squeaky toy</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 23.62% by weight). Phthalates may harm the health of children, causing possible damage to their reproductive system. This product does not comply with the REACH Regulation.	Withdrawal of the product from the market
A12/00318/24	France	<b>Toy rattle</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The rattle can easily break and release the small balls inside it. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with European standard EN 71-1.	Recall of the product from end users
A12/00320/24	Austria	<b>Toy recorder</b>  (Country of Origin: <b>China</b> )		<b>Damage to hearing</b> The sound pressure level produced by the toy is too high (measured value up to 120.5 dB), which could lead to permanent or partial hearing loss. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
A12/00321/24	Austria	<b>Puffer toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> Small pieces can easily detach from the caterpillar. A small child may put these small pieces in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard 71-1.	Recall of the product from end users

A12/00322/24	France	<b>Toy cell phone</b>  (Country of Origin: <b>China</b> )		<b>Chemical, Choking</b>  The battery compartment can easily be opened without the use of tools, which makes the button cells inside accessible to children. A child could put the batteries in their mouth, which could cause choking and damage to the digestive tract if they are swallowed. The product does not comply with the requirements of the Toy Safety Directive and European standard EN 62115.	Withdrawal of the product from the market
A12/00323/24	France	<b>Push along toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b>  The toy has small pieces (small beads on the antennas) that can easily detach. A small child can put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
A12/00324/24	France	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking, Suffocation</b>  Small parts (the eyes) can easily detach from the toy. A small child may put them in their mouth and choke. Moreover, the plastic of the packaging is too thin. If a child plays with the packaging, it can cover their mouth and nose, causing the child to suffocate. The product does not comply with the requirements of the Toy Safety Directive, nor with European standard EN 71-1.	Removal of this product listing by the online marketplace
A12/00325/24	France	<b>Soother</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b>  The soother releases an excessive amount of bisphenol A (measured value up to 0.62 mg/kg). Bisphenol A has endocrine disrupting properties and affects the mammary glands, reproductive and immune systems and may impair the brain's development and behaviour. This product does not comply with the requirements of the General Product Safety Directive.	Removal of this product listing by the online marketplace

A12/00326/24	France	<b>Soother</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b>  The soother releases an excessive amount of bisphenol A (measured value up to 0.31 mg/kg). Bisphenol A has endocrine disrupting properties and affects the mammary glands, reproductive and immune systems and may impair the brain's development and behaviour. This product does not comply with the requirements of the General Product Safety Directive.	Removal of this product listing by the online marketplace
A12/00327/24	France	<b>Soother</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b>  The soother releases an excessive amount of bisphenol A (measured value up to 0.09 mg/kg). Bisphenol A has endocrine disrupting properties and affects the mammary glands, reproductive and immune systems and may impair the brain's development and behaviour. This product does not comply with the requirements of the General Product Safety Directive.	Removal of this product listing by the online marketplace
A12/00341/24	Sweden	<b>LED necklace</b>  (Country of Origin: <b>China</b> )		<b>Environment</b>  The solders in the product have an excessive concentration of cadmium (measured value up to 0.3% by weight). Cadmium bio-accumulates and poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Withdrawal of the product from the market
A12/00360/24	Cyprus	<b>Toy glasses and nose</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b>  The plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) and dibutyl phthalate (DBP) (measured values up to 31.27% and 0.22% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Withdrawal of the product from the market

A12/00366/24	Poland	<b>Toy gun set</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The suction cups of the projectiles can easily detach. A small child could put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
A12/00378/24	Germany	<b>Nesting toy dolls</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has small parts (parts of the smallest figure of the set). A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace
A12/00391/24	France	<b>Balloons</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The rubber of the balloons releases an excessive amount of N-nitrosatable substances (NDMA and NDBA, total measured value up to 2.83 mg/kg). These nitrosamines may cause cancer through ingestion or dermal exposure. A child could be exposed to them when touching or putting the product in their mouth. The product does not comply with the requirements of the Toy Safety Directive nor with the European Standard EN 71-12.	Withdrawal of the product from the market
A12/00402/24	Czechia	<b>Plastic doll</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The plastic material of the doll has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP), and diisononyl phthalate (DINP) (measured values up to 6.2% and 26.1% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Withdrawal of the product from the market

A12/00424/24	Malta	<b>Head support strap</b>  (Country of Origin: <b>Türkiye</b> )		<b>Injuries, Suffocation</b> Due to the form of the head support, it can slip down and cover the nose and mouth of the child, who will not be able to breathe. This can also cause injuries to the child in the case of an accident. The product does not comply with the requirements of the General Product Safety Directive.	Recall of the product from end users
A12/00425/24	Sweden	<b>Slime kit</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The migration of boron from the toy slime is too high (measured value up to 1,000 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Recall of the product from end users
A12/00426/24	Sweden	<b>Balloons</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The balloons release an excessive amount of nitrosatable substances (measured total value up to 0.1 mg/kg). Nitrosatable substances can be transformed into nitrosamines which may cause cancer through ingestion or dermal exposure. A child could be exposed to them when touching or putting the product in their mouth. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-12.	Recall of the product from end users
INFO/00037/24	Sweden	<b>LED mask</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 70% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS Directive).	Withdrawal of the product from the market

INFO/00042/24	Cyprus	<b>Squeaky toy</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b>  The toy has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 23.8% by weight). This phthalate may harm children's health by possibly causing damage to their reproductive system. The product does not comply with the REACH Regulation.	Fine
---------------	--------	--	---	---	------

## Safety Gate: the EU rapid alert system for dangerous non-food products

“Safety Gate”, the EU rapid alert system (formerly known as “RAPEX”), enables the rapid exchange of information between **31 European countries** and the European Commission on non-food dangerous products found on the market posing a risk to the health and safety of consumers.

A weekly overview of the alerts on those products is published in English for free on <https://ec.europa.eu/safety-gate-alerts/screen/webReport#weeklyReports>. The measures taken in the notifying country in order to restrict such products’ marketing or use can be ordered by national authorities (“compulsory measures”) or be taken directly by producers and distributors (“voluntary measures”).

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 of the General Product Safety Directive (**2001/95/EC**) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

## Recall Summary – US Toys / Children’s Products

**CPSC Recall List (Feb 2024)**

Recall No.	Notifying Country	Product	Product Photo	Hazard / Risk	Remedy
24-096	USA	<b>Fishing Games</b>  (Country of Origin: <b>China</b> )		<p><b>Magnet Ingestion Hazard</b>            Huihuang Trading Recalls Fishing Games Due to Magnet Ingestion Hazard, Violation of the Federal Safety Regulation for Toys; Sold Exclusively on Amazon.com</p> <p>The fishing game does not comply with the requirements of the mandatory federal toy regulation because it contains one or more magnets that fit within CPSC’s small parts cylinder and the magnets are stronger than permitted. When high-powered magnets are swallowed, the ingested magnets can attract to each other, or another metal object, and become lodged in the digestive system. This can result in perforations, twisting and/or blockage of the intestines, infection, blood poisoning and death.</p>	<p>Consumers should stop using the recalled fishing game immediately, take it away from children and contact Huihuang Trading to receive a pre-paid label to return the recalled products. Upon receipt of the products, consumers will receive a full refund. Huihuang Trading Inc. is notifying all known purchasers directly.</p>

24-097	USA	<p><b>Magnetic DIY Balls Magic Cube, 5 mm</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Magnet Ingestion Hazard</b></p> <p>DailySale Recalls High-Powered Magnetic Balls Due to Ingestion Hazard; Violation of the Federal Safety Regulation for Toy Magnet Sets</p> <p>The magnetic ball sets do not comply with the requirements of the mandatory federal toy regulation because they contain one or more magnets that fit within CPSC's small parts cylinder and the magnets are stronger than permitted. When high-powered magnets are swallowed, the ingested magnets can attract to each other or to another metal object and become lodged in the digestive system. This can result in perforations, twisting and/or blockage of the intestines, infection, blood poisoning and death.</p>	<p>Consumers should stop using the recalled magnetic balls immediately, take them away from children, and contact DailySale to receive a pre-paid label to return the recalled magnetic balls for a full refund. DailySale is notifying all known purchasers directly.</p>
--------	-----	--	---	---	--

24-098	USA	<p><b>Slide &amp; Seek Ball Runs with Wooden Knobs</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Choking Hazard</b></p> <p>Lovevery Recalls Slide &amp; Seek Ball Runs with Wooden Knobs Due to Choking Hazard</p> <p>The packaging configuration can allow damage to the wooden knob on the Ball Run during shipping and cause it to come loose and detach, posing a choking hazard to children.</p>	<p>Consumers with a recalled ball run should immediately take it away from children, stop using it, and contact Lovevery for a free replacement. Consumers will receive a free replacement after registering on the firm's website, removing and marking the affected door with a specific case number (which will be emailed to known purchasers), uploading a photo of their marked door to <a href="http://www.recallrtr.com/ballrun">www.recallrtr.com/ballrun</a>, and affirming to Lovevery that the door will be disposed of in the trash. Lovevery is contacting all known purchasers directly.</p>
24-100	USA	<p><b>Ekouaer Girl's Nightgowns</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Fire and Burn Hazard</b></p> <p>Children's Nightgowns Recalled Due to Fire and Burn Hazard; Violation of Federal Flammability Regulations; Imported by Shenzhen Weite Information Technology Co., Ltd.; Sold Exclusively by Ekouaer at Amazon.com</p> <p>The children's nightgowns fail to meet federal flammability regulations for children's sleepwear, posing a risk of burn injuries to children.</p>	<p>Consumers should immediately take the recalled nightgowns away from children, stop using them and contact Ekouaer for a full refund. Consumers should destroy the nightgowns by cutting them both vertically and horizontally and disposing of them in accordance with local and state recycling laws. Consumers should send an image of the destroyed recalled nightgowns to Ekouaer by email at <a href="mailto:walshkelly15@gmail.com">walshkelly15@gmail.com</a>. Upon receipt of the photo, consumers will be issued a full refund of the purchase price.</p>

24-101	USA	<p><b>Children's Nightgowns</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Fire and Burn Hazard</b></p> <p>Children's Nightgowns Recalled Due to Fire and Burn Hazard; Violation of Federal Flammability Regulations; Imported by Stripe and Stare</p> <p>The recalled children's nightgowns violate the federal flammability regulations for children's sleepwear, posing a risk of burn injuries to children.</p>	<p>Consumers should immediately take the recalled nightgowns away from children, stop using them and contact Stripe and Stare for a full refund. Consumers should destroy the garments by cutting them in half and send Stripe and Stare a photo of the destroyed product by email at <a href="mailto:hellousa@stripeandstare.com">hellousa@stripeandstare.com</a>. Upon receipt of the photo, Stripe and Stare will issue a full refund of the purchase price.</p>
24-104	USA	<p><b>NextGen Children's Bicycles</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Crash and Injury Hazards</b></p> <p>Flat River Group Recalls Children's Bicycles Due to Crash and Injury Hazards; Violation of Federal Safety Regulations for Bicycles</p> <p>The bicycles do not meet U.S. safety standards for bicycles, posing crash and injury hazards to children. The 10-inch, 12-inch, and 16-inch bicycles are equipped with hand brakes but no footbrakes. The 20-inch bicycles are not equipped with a chain guard and the pedals do not come with reflectors. Federal regulations require bicycles with seat heights that measure at or below 25 inches to be equipped with foot brakes and require a full coverage chain guard, intended to prevent entrapment of clothing or body parts.</p>	<p>Consumers should immediately take the recalled bikes away from children, stop using them, and contact the firm for instructions on returning the bicycles for a full refund.</p>

24-106	USA	<p><b>Snow Globes (Little Wanderer)</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Laceration Hazard</b></p> <p>The Museum of Modern Art Recalls Glass Little Wanderer Snow Globes Due to Laceration Hazard; Sold Exclusively at MoMA Design Stores</p> <p>The snow globes can crack or fracture, posing a laceration hazard.</p>	<p>Consumers should immediately stop using and discard the recalled snow globes. Contact the Museum of Modern Art for a full refund. The museum is contacting all known purchasers.</p>
24-114	USA	<p><b>Lolanta Children's Hooded Flannel Bathrobes</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Burn Hazard</b></p> <p>Children's Bathrobes Recalled Due to Burn Hazard and Violation of Flammability Regulations; Sold by Nanchang Zhongcangjishi E-commerce</p> <p>The recalled children's bathrobes violate federal flammability regulations for children's sleepwear, posing a risk of burn injuries to children.</p>	<p>Consumers should immediately take the recalled bathrobes away from children, stop using them and contact Nanchang Zhongcangjishi E-commerce for a full refund. Consumers should destroy the garments by cutting them in half and email a photo of the destroyed garment to <a href="mailto:business@lolanta.com">business@lolanta.com</a>. Upon receipt of the photo, consumers will be issued a full refund of the purchase price.</p>
24-118	USA	<p><b>Bell Soquel Youth Helmets</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Risk of Head Injury</b></p> <p>Bell Sports Recalls Bell Soquel Youth Bicycle Helmets Due to Risk of Head Injury; Violation of the Federal Safety Regulation for Bicycle Helmets</p> <p>The strap anchor can become dislodged from the helmet when sufficient force is applied, and therefore violates the CPSC federal safety regulation for bicycle helmets. The helmets can fail to protect in the event of a crash, posing a risk of head injury.</p>	<p>Consumers should immediately stop using the recalled Bell Soquel Youth Helmets and contact Bell Sports for a refund. To receive a refund, consumers should destroy the helmet by cutting off the straps and upload photos of the helmet with the straps cut to <a href="mailto:consumersupport-bell@bellhelmets.com">consumersupport-bell@bellhelmets.com</a> to prove destruction, then dispose of the recalled helmet.</p>

24-133	USA	<p><b>Vanilla Underground “Minecraft TNT” One-Piece Pajamas</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Burn Hazard</b></p> <p>Vanilla Underground Minecraft TNT Children’s Pajamas Recalled Due to Burn Hazard and Violation of Federal Flammability Regulations; Imported by Premier P</p> <p>The recalled children’s pajamas fail to meet the federal flammability regulations for children’s sleepwear, posing a risk of burn injuries to children.</p>	<p>Consumers should immediately take the recalled pajamas away from children, stop using them and contact Vanilla Underground for a full refund. Consumers should destroy the garments by cutting them in half and disposing of them in accordance with local and state recycling laws. Consumers should send a photo of the destroyed garment to <a href="mailto:customercare@vanillaunderground.com">customercare@vanillaunderground.com</a>. Upon receipt of the photo, consumers will be issued a full refund of the purchase price.</p>
24-135	USA	<p><b>Children’s Pajama Sets</b></p> <p>(Country of Origin: <b>Sri Lanka</b>)</p>		<p><b>Burn Hazard</b></p> <p>Oso &amp; Me Recalls Children’s Pajama Sets Due to Burn Hazard; Violation of the Federal Flammability Regulations for Children’s Sleepwear</p> <p>The recalled children’s pajama sets violate the flammability regulations for children’s sleepwear, posing a risk of burn injuries to children.</p>	<p>Consumers should stop using the children’s pajamas immediately and contact Oso &amp; Me for a full refund. Consumers who purchased the product will be asked to destroy the garment by cutting the top and bottom in half, and sending the recalling firm a photo of the destroyed garment to <a href="mailto:ProductRecall@osoandme.com">ProductRecall@osoandme.com</a>. Upon receipt of the photo, consumers will be issued a full refund of the purchase price.</p>

24-136	USA	<p><b>2021 through 2023 Model Year Cannondale Dave Bicycles</b></p> <p>(Country of Origin: Taiwan)</p>		<p><b>Fall and Injury Hazards</b></p> <p>Cannondale Recalls Dave Bicycles Due to Fall and Injury Hazards</p> <p>The bicycle head tube / downtube weld can become damaged, and separate from the bicycle frame, posing fall and injury hazards.</p>	<p>Consumers should immediately stop using the recalled bicycles and contact an authorized Cannondale dealer for a free replacement frame.</p>
24-138	USA	<p><b>Liverpool Football Club (L.F.C.) Children's Pajamas</b></p> <p>(Country of Origin: China)</p>		<p><b>Burn Hazard</b></p> <p>Children's Pajamas Recalled Due to Burn Hazard and Violation of Federal Flammability Standards; Sold Exclusively by Liverpool Football Club</p> <p>The recalled children's pajamas fail to meet the flammability standards for children's sleepwear, posing a risk of burn injuries to children.</p>	<p>Consumers should immediately take the recalled pajamas away from children, stop using them and contact Liverpool Football Club for a full refund. Consumers should destroy the garments by cutting them in half and disposing of them in accordance with local and state recycling laws. Consumers should send the recalling firm a photo of the destroyed garment using <a href="https://store.liverpoolfc.com/us-product-recall">https://store.liverpoolfc.com/us-product-recall</a>. Upon receipt of the photo, consumers will be issued a full refund of the purchase price.</p>

24-141	USA	<p><b>Sandford Family 6-Player Croquet Sets</b></p> <p>(Country of Origin: <b>India</b>)</p>		<p><b>Poisoning Hazard</b></p> <p>Sandford Family Croquet Sets Recalled Due to Violations of the Federal Lead Paint and Phthalates Bans; Sold Exclusively on Amazon by DOM Sports</p> <p>The paint or surface coating on the red mallet, blue mallet, red hoop, and winning post contain levels of lead that exceed the federal lead paint ban, posing a lead poisoning hazard. In addition, the coating on the red and blue mallets contains levels of regulated phthalates that exceed the prohibition of specific phthalates. Lead and phthalates are toxic if ingested by young children and can cause adverse health issues.</p>	<p>Consumers should immediately stop using the recalled family croquet sets, and contact DOM Sports for information on how to email a photo of the recalled product being disposed of to support@domsports.com to receive the free replacement parts. DOM Sports and Amazon are contacting all known purchasers.</p>
24-738	USA	<p><b>Magik &amp; Kover Pack and Play Mattresses</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Suffocation Hazard</b></p> <p>Magik &amp; Kover Pack and Play Mattresses Recalled Due to Suffocation Hazard for Infants; Violations of the Federal Safety Regulation for Crib Mattresses; Sold Exclusively on Amazon.com by Magik &amp; Kover (Recall Alert)</p> <p>The recalled mattresses violate multiple provisions of the federal safety regulation for crib mattresses, including the thickness test, and are missing warnings and labels. The product poses a suffocation hazard to infants.</p>	<p>Consumers should immediately stop using and destroy the recalled mattresses, and contact Magik &amp; Kover to receive a full refund and for directions on how to dispose of the mattress. Magik &amp; Kover and Amazon are contacting all know purchasers directly.</p>

24-739	USA	<p><b>Spring Spirit and Biloban Pack and Play Mattresses</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Suffocation Hazard</b></p> <p>Spring Spirit and Biloban Pack and Play Mattresses Recalled Due to Suffocation Hazard to Infants; Violations of the Federal Safety Regulation for Crib Mattresses; Sold Exclusively on Amazon.com by Biloban (Recall Alert)</p> <p>The recalled mattresses violate multiple provisions of the federal safety regulation for crib mattresses, including the thickness test, and are missing warnings and labels. The product poses a suffocation hazard to infants.</p>	<p>Consumers should immediately stop using and destroy the recalled mattresses, and contact Biloban to receive a full refund and for directions on how to dispose of the mattresses. Biloban and Amazon are contacting all know purchasers directly.</p>
--------	-----	---	---	--	--

\* Source: [www.recalls.gov](http://www.recalls.gov)

## CPSC

The United States Consumer Product Safety Commission (CPSC) is an independent agency of the United States Government. To provide better service in alerting the American people to unsafe, hazardous or defective products, a “one stop shop” for U.S. Government recalls, <http://www.recalls.gov>, has been created. Members of the public may report unsafe products to CPSC by using the platform.

The recall list is divided into seven categories: Consumer Products, Motor Vehicles, Boats, Food, Medicine, Cosmetics and Environmental Products. Generally, the recall is conducted voluntarily by the company under CPSC’s Fast Track Recall program. Fast Track recalls are initiated by firms who are committed to working with CPSC to quickly announce the recall and remedy to protect consumers.

## Recall Summary – Australia Toys / Children’s Products

**ACCC Recall List (Feb 2024)**

PRA No.	Notifying Country	Product / Description	Product Photo	Hazard / Risk	Remedy
2024/20024	Australia	<p><b>Silicone nesting bear stacking toy in: baby pink (SKU - BBY236) baby blue (SKU - BBY237)</b></p> <p><b>SKU can be found on the packaging of the product.</b></p>		<p><b>Risk of Choking</b></p> <p>The toy does not comply with the size and shape requirements of the mandatory safety standard for toys for children up to and including 36 months of age.</p> <p>There is a risk of choking, suffocation or death to young children if they put small parts into their mouth.</p>	<p>Consumers should stop using the toy immediately and return it to the place of purchase for a refund.</p> <p>For more information, consumers can contact Splosh by phone: 07 3805 4718 (8:00 am – 4:00 pm, Monday to Friday) or via email at <a href="mailto:credits@splosh.com.au">credits@splosh.com.au</a>.</p>

2024/20027	Australia	<p><b>Wooden stacking tree with 19 wooden animals and leaves. Affected SKU TL8409 is printed on a sticker on the base of the tree.</b></p>		<p><b>Risk of Choking</b>  <b>The product does not comply with the mandatory safety standard for toys for children up to and including 36 months of age. The leaves of the wooden stacking tree are small parts.</b></p> <p><b>There is a risk of choking, suffocation or death to young children if they put the small parts into their mouth.</b></p>	<p>Consumers should remove the leaves from the toy immediately and dispose of them.</p> <p>Consumers should contact Kaleidoscope to arrange replacement leaves to be sent to them free of charge.</p> <p>Consumers will need to provide Kaleidoscope with evidence that the original leaves have been disposed of.</p> <p>For more information, consumers can contact Kaleidoscope by phone on 07 3375 6446 or by email at <a href="mailto:products@kaleidoscope.com.au">products@kaleidoscope.com.au</a></p>
2024/20054	Australia	<p><b>Pinwheel toy supplied as a giveaway at Cotton On Kids stores.</b></p>		<p><b>Risk of Choking</b>          Affected products do not comply with the mandatory standard for toys for children up to and including 36 months of age. The fastener cap on the pinwheel toy can detach during play.</p> <p>There is a risk of choking, suffocation or death to young children if they put the fastener cap into their mouth.</p>	<p>Consumers should stop using the pinwheel toy immediately and dispose of it or return it to a Cotton On Kids store or Cotton On Mega store.</p>

2024/20058	Australia	<p><b>Soft synthetic octopus with elasticated sticky legs in four colours:</b></p> <p><b>pink</b> <b>green</b> <b>yellow</b> <b>blue</b></p>		<p><b>Strangulation Hazard</b></p> <p>There is a permanent ban on yo-yo water balls (and similar products).</p> <p>This product has elasticated legs which extend further than the maximum allowed length of 500mm set by the ban.</p> <p>There is a risk of death or serious injury from strangulation. The legs can stretch and wind around a child's neck, especially if swung around the head.</p>	<p>Consumers should stop using the toy immediately and cut the legs. Return to the place of purchase for a full refund.</p>
2024/20090	Australia	<p><b>Set of 4 duck bath toys for children. Duck set includes 1 large duck and 3 small ducks.</b></p>		<p><b>Risk of Choking</b></p> <p>The product does not comply with the mandatory safety standard for toys for children up to and including 36 months of age.</p> <p>The squeaker may detach from the duck and create a small part that can be swallowed.</p> <p>There is a risk of choking, suffocation or death if the squeaker detaches from a toy duck and is swallowed.</p>	-

## Australian Product Safety System

The Australian product safety system is set up to maximize the safety of goods through the cooperation of consumers, businesses and agencies. This policy sets out the principles adopted by the Australian Competition and Consumer Commission (ACCC) for prioritizing and addressing product safety risks.

Under the Australian Consumer Law, a responsible Minister can order a compulsory recall when there are hazards on the products. A voluntary recall could be conducted to remove the product from the marketplace when the suppliers become aware of unsafe or defective products.

The ACCC administers a national recalls system for recalls of specific and general consumer products, and publishes all product recalls on the website <https://www.productsafety.gov.au/recalls>.

STC (Hong Kong Standards and Testing Centre) is a not-for-profit, independent testing, inspection and certification organization. With a global network of ISO/IEC 17025 accredited testing laboratories and over 60 years of experience in consumer product testing, we can meet your conformity assessment needs with highly efficient and reliable service. Our testing scope and capabilities related to toys and children's products include but are not limited to:

### EU Requirements

- EN 71
- Phthalates (EC) no. 1907/2006
- Nickel Release (EC) no. 1907/2006
- Total Cadmium (EEC) no. 91/338
- Lead in Jewellery product (EC) no. 836/2012
- Azo-dye (EC) no. 1907/2006
- Bisphenol-A (2014/81/EU)
- DMF (Dimethyl fumarate) (EU) no. 2011/135
- Flame retardants TCEP, TCPP, TDCP (2014/79/EU)
- Package Waste Directive (94/62/EC)

### US & Canada Requirements

- ASTM F963
- CPSIA
- California Proposition 65
- 16 CFR 1501
- ASTM F2923 (Children's jewellery)
- ASTM F2999 (Adult's jewellery)
- US Toxic in Packaging Clearinghouse (TPCH)
- CCPSA - Toys Regulations (SOR/2011-17)

### Japan Requirements

- Japan Toy Safety Standard (ST)
- Japan Food Sanitation Law (JFSL)

### Australia Requirements

- AS/NZS 8124
- Consumer Protection Notice No. 6 of 2010 - DEHP

#### FOR MORE DETAILS, PLEASE CONTACT US:

Hong Kong: [hktcd@stc.group](mailto:hktcd@stc.group)    Guangdong: [gdtcd@stc.group](mailto:gdtcd@stc.group)    Shanghai: [shtcd@stc.group](mailto:shtcd@stc.group)  
Changzhou: [czstc@stc.group](mailto:czstc@stc.group)    Vietnam: [vnstc@stc.group](mailto:vnstc@stc.group)    Japan: [jpo@stc.group](mailto:jpo@stc.group)  
U.S.A.: [usenquiry@stc.group](mailto:usenquiry@stc.group)    Germany: [grstc@stc.group](mailto:grstc@stc.group)

