







## Recall Summary – European Toys






### EU Safety Gate Alerts (May 2025)





Alert No.	Notifying Country	Product	Product Photo	Hazard / Risk	Measures Adopted
OR/00066/25	France	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The product has a zipped fastening making the fibrous stuffing material easily accessible. A child may put the filling material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
OR/00068/25	Italy	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. A small child may put the filling material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Ban on the marketing of the product and any accompanying measures
OR/00076/25	Belgium	<b>Plastic swing</b>  (Country of Origin: <b>China</b> )		<b>Injuries</b> The product has accessible openings and holes, in which children's head or neck can become trapped and suffer injuries. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-8.	Recall of the product from end users
OR/00077/25	UK	<b>Plush toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The fibrous stuffing material of the toy is easily accessible due to the weakness of the seams on the front legs. A small child may put the filling material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive.	Withdrawal of the product from the market

OR/00079/25	France	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The fibrous stuffing material of the toy is easily accessible due to the weakness of the seams on the back. A small child may put the filling material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/01621/25	Norway	<b>Climbing frame</b>  (Country of Origin: <b>Unknown</b> )		<b>Entrapment, Injuries, Strangulation</b> The product has too large openings between rungs as well as the climbing net where the body can pass but not the head of a small child and may cause strangulation. Moreover, the frame is not stable and can tip over causing the child to fall and suffer injuries. The product does not comply with the requirements of the Toy Safety Directive nor with the European standards EN 71-8.	Recall of the product from end users
SR/01626/25	France	<b>Pull-along toy</b>  (Country of Origin: <b>China</b> )		<b>Chemical, Choking, Injuries</b> The battery compartment can be easily opened, leaving the button batteries accessible. A child may put them in the mouth and swallow them, which could cause damage to the child's gastrointestinal tract and/or choking. In addition, the cross section of the rope to pull the turtle is too small. This could cause injuries to the child playing with the toy. The product does not comply with the requirements of the Toy Safety Directive nor with the European standards EN 71-1 and EN 62115	Removal of this product listing by the online marketplace
SR/01632/25	France	<b>Toy slime</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The migration of boron from the toy slime is too high (measured value up to 11419 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Withdrawal of the product from the market

SR/01641/25	Poland	<b>Plastic ball</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The toy contains an excessive amount of dibutyl phthalate (DBP) and diisobutyl phthalate (DIBP) (measured values up to 3.75% and 8.5% by weight, respectively). These phthalates may harm the health of children by causing possible damage to the reproductive system. The product does not comply with the REACH Regulation.	Warning consumers of the risks
SR/01643/25	Poland	<b>Toy rattle</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The rattle can break easily and release small plastic parts (plastic balls). A child may put the small plastic parts into their mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/01646/25	Norway	<b>Climbing frame</b>  (Country of Origin: <b>Ukraine</b> )		<b>Entrapment, Injuries, Strangulation</b> The product has too large openings between rungs as well as the climbing net where the body can pass but not the head of a small child and may cause strangulation. Moreover, the frame is not stable and can tip over causing the child to fall and suffer injuries. The product does not comply with the requirements of the Toy Safety Directive nor with the European standards EN 71-1 and EN 71-8.	Recall of the product from end users
SR/01649/25	Ireland	<b>Ball runner toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The top rung of the toy can easily detach, making the small balls inside accessible. A small child can put these balls in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive	Recall of the product from end users
SR/01683/25	Austria	<b>Wooden toy truck</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has small parts (wooden parts and screws) that can easily detach. A small child may put them in their mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Stop of sales

SR/01684/25	Austria	<b>Wooden puzzle</b>  (Country of Origin: <b>Germany</b> )		<b>Choking</b> The toy has small parts (wooden parts) that can easily detach. A small child may put them in their mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive or with European standard EN 71-1.	Recall of the product from end users
SR/01691/25	Poland	<b>Magnetic toy</b>  (Country of Origin: <b>China</b> )		<b>Injuries</b> The toy contains small magnets with a high magnetic flux (measured value up to 50 kG <sup>2</sup> mm <sup>2</sup> ). If a child swallows the small magnets, they could attract one another causing intestinal blockage or perforation. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Destruction of the product
SR/01696/25	Germany	<b>Children's car seat</b>  (Country of Origin: <b>Poland</b> )		<b>Injuries</b> The child seat can become separated from the base due to faulty locking. This may mean that the child seat is not properly secured, resulting in injuries in the event of an accident. The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.	Recall of the product from end users
SR/01699/25	France	<b>High chair</b>  (Country of Origin: <b>France</b> )		<b>Suffocation</b> Small parts can easily detach (butterfly screw). As a consequence, a small child may put them in their mouth and choke on them. The product does not comply with the General Product Safety Regulation nor with the European standard EN 14988.	Removal of this product listing by the online marketplace
SR/01714/25	France	<b>Stress ball</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has small parts which can detach (eyes). A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with European standard EN 71-1.	Recall of the product from end users






SR/01721/25	France	<b>Fancy-dress costume</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The product contains chromium VI (measured value up to 0.19 mg/kg). Chromium VI is sensitising, can trigger allergic reactions and can cause cancer. The product does not comply with the requirements of the Toy Safety Directive nor with the REACH Regulation and the European standard EN 71-3.	Recall of the product from end users
SR/01725/25	Poland	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> Small parts can easily detach (plastic eye). As a result, a small child may put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/01731/25	Germany	<b>Wooden ring toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The wooden ring can break easily, resulting in small pieces. A child may put them into their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/01732/25	France	<b>Watercolour set</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The product contains mercury (measured value up to 14.6%). Mercury accumulates in the body and can damage the kidneys, brain and nervous system. Additionally, it may affect reproduction and the unborn child. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Recall of the product from end users
SR/01753/25	France	<b>Toy wand</b>  (Country of Origin: <b>China</b> )		<b>Burns</b> Due to the insufficient mechanical strength of the toy, in particular of the unicorn plastic head, a short circuit may occur, breaking the toy. This may cause burns to the user. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 62115.	Withdrawal of the product from the market

SR/01756/25	UK	<b>Skipping rope toy</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The plastic material of the toy has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP), diisobutyl phthalate (DIBP) and dibutyl phthalate (DBP) (measured values up to 0.04%, 0.03 and 13.85% by weight, respectively). These phthalates may harm the health by causing possible damage to the reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with REACH.	Import rejected at border
SR/01763/25	UK	<b>Baby sleeping bag</b>  (Country of Origin: <b>Unknown</b> )		<b>Suffocation</b> The product has no arm openings. As a result, the baby may slip down into the sleep bag and suffocate. The product does not comply with the requirements of the General Product Safety Directive.	Removal of this product listing by the online marketplace
SR/01765/25	UK	<b>Baby sleeping bag</b>  (Country of Origin: <b>Unknown</b> )		<b>Suffocation</b> The product has no arm openings. As a result, the baby may slip down into the sleep bag and suffocate. The product does not comply with the requirements of the General Product Safety Directive.	Removal of this product listing by the online marketplace
SR/01767/25	UK	<b>Musical toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> Small parts can easily detach (plastic component on the cord). A small child may put them in their mouth and choke. Furthermore, the product lacks appropriate warnings on the label. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Destruction of the product





SR/01768/25	UK	<b>Children's scooter</b>  (Country of Origin: <b>China</b> )		<b>Injuries, Suffocation</b> The screw-clamp locking device on the steering column may fail to stop the column from dropping during use. This could cause the child to fall and be injured. Additionally, the product lacks the appropriate instructions for use when folding and unfolding the scooter. If this is not correctly done, it increases the risk of injuries to the user. Moreover, the steering column is in a plastic bag which is too thin. If a child plays with it, the plastic can cover the mouth and nose, causing the child to suffocate. The product does not comply with the requirements of the Toy Safety Directive.	Import rejected at border
SR/01769/25	UK	<b>Toy dinosaur</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The product has a small part (the bone intended to be placed in the dinosaur's mouth). A small child may put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive	Import rejected at border
SR/01770/25	Czechia	<b>Toy slime</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The migration of boron from the toy slime is too high (measured value up to 790 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Ban on the marketing of the product and any accompanying measures
SR/01771/25	Italy	<b>Puzzle mat</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy can easily break producing small parts. Small children may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Ban on the marketing of the product and any accompanying measures





SR/01772/25	Italy	<b>Puzzle mat</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy can easily break producing small parts. Small children may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Ban on the marketing of the product and any accompanying measures
SR/01776/25	UK	<b>Stacking toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The drawstring bag of the toy has a small part (plastic toggle) which can be easily detached. A child may put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive.	Destruction of the product
SR/01777/25	Spain	<b>Soft toy</b>  (Country of Origin: <b>Hungary</b> )		<b>Choking</b> The toy has small parts which can detach (eye and suction cup). A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with European standard EN 71-1.	Ban on the marketing of the product and any accompanying measures
SR/01782/25	France	<b>Toy slime</b>  (Country of Origin: <b>China</b> )		<b>Chemical, Choking</b> The product has small parts (small blue and pink plastic balls). A small child may put them in their mouth and choke. Additionally, the plastic pieces have an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP), and dibutyl phthalate (DBP) (measured value up to 4% in total). These phthalates may harm the health by causing possible damage to the reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with REACH and the European standard 71-1.	Recall of the product from end users



SR/01783/25	Poland	<b>Toy rattle set</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The money and zebra-shaped rattles have protruding parts. A child could put them in the mouth, which could block the airways and cause choking. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Warning consumers of the risks
SR/01792/25	Poland	<b>Plastic toy</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The toy contains an excessive amount of bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 13.3% by weight). This phthalate may harm the health of children, possibly by causing damage to the reproductive system. The product does not comply with the REACH Regulation.	Warning consumers of the risks
SR/01797/25	UK	<b>Baby sleeping bag</b>  (Country of Origin: <b>Unknown</b> )		<b>Suffocation</b> The sleeping bag has a hood, which may cover the mouth and/or nose area of the baby. This could lead the child to suffocate. The product does not comply with the requirements of the General Product Safety Directive.	Removal of this product listing by the online marketplace
SR/01801/25	UK	<b>Baby sleeping bag</b>  (Country of Origin: <b>Unknown</b> )		<b>Suffocation</b> The sleeping bag has a hood, which may cover the mouth and/or nose area of the baby. This could lead the child to suffocate. The product does not comply with the requirements of the General Product Safety Directive.	Removal of this product listing by the online marketplace
SR/01806/25	UK	<b>Baby sleeping bag</b>  (Country of Origin: <b>China</b> )		<b>Suffocation</b> The sleeping bag has a hood, which may cover the mouth and/or nose area of the baby. This could lead the child to suffocate. The product does not comply with the requirements of the General Product Safety Directive.	Removal of this product listing by the online marketplace





SR/01807/25	UK	<b>Baby sleeping bag</b>  (Country of Origin: <b>Unknown</b> )		<b>Suffocation</b> The product has no arm openings. As a result, the baby may slip down into the sleep bag and suffocate. The product does not comply with the requirements of the General Product Safety Directive.	Removal of this product listing by the online marketplace
SR/01812/25	UK	<b>Baby sleeping bag</b>  (Country of Origin: <b>Unknown</b> )		<b>Suffocation</b> The sleeping bag has a hood, which may cover the mouth and/or nose area of the baby. This could lead the child to suffocate. The product does not comply with the requirements of the General Product Safety Directive.	Removal of this product listing by the online marketplace
SR/01817/25	UK	<b>Baby sleeping bag</b>  (Country of Origin: <b>China</b> )		<b>Suffocation</b> The sleeping bag has a hood, which may cover the mouth and/or nose area of the baby. This could lead the child to suffocate. The product does not comply with the requirements of the General Product Safety Directive.	Removal of this product listing by the online marketplace
SR/01819/25	UK	<b>Baby sleeping bag</b>  (Country of Origin: <b>Unknown</b> )		<b>Suffocation</b> The product has no arm openings. As a result, the baby may slip down into the sleep bag and suffocate. The product does not comply with the requirements of the General Product Safety Directive.	Removal of this product listing by the online marketplace
SR/01820/25	UK	<b>Baby sleeping bag</b>  (Country of Origin: <b>Unknown</b> )		<b>Suffocation</b> The product has no arm openings. As a result, the baby may slip down into the sleep bag and suffocate. The product does not comply with the requirements of the General Product Safety Directive.	Removal of this product listing by the online marketplace
SR/01823/25	Italy	<b>Fidget toy</b>  (Country of Origin: <b>Bulgaria</b> )		<b>Suffocation</b> The plastic of the packaging is too thin. If a child plays with it, the plastic can cover the mouth and nose, causing the child to suffocate. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Ban on the marketing of the product and any accompanying measures

SR/01824/25	UK	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has small parts (eyes) that can easily detach. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive.	Import rejected at border
SR/01829/25	Poland	<b>Magnetic safety lock</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> Small parts (plastic attachments) can easily detach from the locking mechanism. A small child may put them in their mouth and choke. The product does not comply with the General Product Safety Regulation.	Withdrawal of the product from the market
SR/01831/25	UK	<b>Children's gardening set</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The migration of lead from the yellow paint of the long hoe and the long rake is too high (measured values up to 800 mg/kg and 210 mg/kg respectively). Lead is harmful to children as it can lead to developmental neurotoxicity. It accumulates in the body and may also affect their future progeny when breast-fed or unborn. The product does not comply with the requirements of the Toy Safety Directive.	Recall of the product from end users
SR/01841/25	Spain	<b>Soother</b>  (Country of Origin: <b>Spain</b> )		<b>Choking</b> The plastic parts of the product may easily break, creating small parts. A child may put them into their mouth and choke. The product does not comply with the General Product Safety Directive nor with the European standard EN 1400.	Ban on the marketing of the product and any accompanying measures
SR/01849/25	France	<b>Fancy-dress costume</b>  (Country of Origin: <b>China</b> )		<b>Injuries</b> The product has two non-detachable cords on the costume at the bottom of the trousers. The cords may become trapped during various activities of a child, leading to injuries. The product does not comply with the requirements of the Toy Safety Directive nor with the European standards EN 71-1 and EN 14682.	Withdrawal of the product from the market

SR/01865/25	Germany	<b>Climber playset</b>  (Country of Origin: <b>China</b> )		<b>Entrapment, Strangulation</b> The climber set has accessible openings through which the child could fall or in which the child's head or limbs could become trapped. This could lead to strangulation or entrapment. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-8.	Recall of the product from end users
SR/01876/25	UK	<b>Radio controlled toy car</b>  (Country of Origin: <b>China</b> )		<b>Chemical, Environment</b> According to the product markings, the product has batteries containing cadmium. Cadmium bio-accumulates and poses a risk to the environment. The product does not comply with the requirements of the Batteries and Accumulators Directive.	Import rejected at border
SR/01891/25	France	<b>High chair</b>  (Country of Origin: <b>China</b> )		<b>Injuries, Suffocation</b> The product is not resistant and durable enough, a small child might fall off and be injured if the seat breaks. Moreover, the plastic of the packaging is too thin. If a child plays with it, the plastic can cover the mouth and nose, causing the child to suffocate. The product does not comply with the requirements of the General Product Safety Regulation nor with the European standard EN 14988.	Withdrawal of the product from the market
SR/01896/25	Poland	<b>Plastic doll</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The toy contains an excessive amount of bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 22.4% by weight). This phthalate may harm the health of children, possibly by causing damage to the reproductive system. The product does not comply with the REACH Regulation.	Warning consumers of the risks

SR/01927/25	Luxembourg	<b>Toy sword</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 1200 mg/kg). This phthalate may harm the health by causing possible damage to the reproductive system. The product does not comply with the REACH Regulation.	Ban on the marketing of the product and any accompanying measures
SR/01929/25	Czechia	<b>Plastic doll</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 13.05% by weight). This phthalate may harm the health by causing possible damage to the reproductive system. The product does not comply with the REACH Regulation.	Withdrawal of the product from the market
SR/01938/25	Germany	<b>LED light</b>  (Country of Origin: <b>China</b> )		<b>Chemical, Choking, Injuries</b> The battery compartment can be easily opened, leaving the button batteries accessible. A child may put them in the mouth and swallow them, which could cause damage to the child's gastrointestinal tract and/or choking. In addition, the product can easily break, releasing small parts, that a small child could put in their mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive not with the European standards EN 71-1 and EN 62115.	Recall of the product from end users
SR/01939/25	Germany	<b>Plastic toy</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The head of the toy plastic material has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 33% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Stop of sales

SR/01944/25	Germany	<b>Balloons</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b>  The rubber of the balloons releases an excessive amount of nitrosamines and nitrosatable substances (measured total values up to 2.03 mg/kg and 18.03 mg/kg respectively), among which NDMA. Nitrosamines may cause cancer through ingestion or dermal exposure. A child could be exposed to them when touching or putting the product in the mouth. The product does not comply with the requirements of the Toy Safety Directive.	Warning consumers of the risks
SR/01964/25	France	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b>  Small parts can detach easily (pieces of wood from the ring). A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with European standard EN 71-1.	Withdrawal of the product from the market
SR/01969/25	Germany	<b>Dice set</b>  (Country of Origin: <b>China</b> )		<b>Choking</b>  The dice constitute small parts. Small children may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Import rejected at border
SR/01984/25	Germany	<b>Toy car</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b>  The rubber of the toy releases an excessive amount of nitrosatable substances (measured total value up to 2.5 mg/kg), which generate nitrosamines, among which is NDMA. Nitrosamines may cause cancer through ingestion or dermal exposure. A child could be exposed to them when touching or putting the product in the mouth. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-12.	Ban on the marketing of the product and any accompanying measures

SR/01985/25	Sweden	<b>Battery-operated toy dog</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have excessive concentrations of lead (measured value up to 53% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/01988/25	Sweden	<b>Battery-operated toy dog</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 71% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/01989/25	Sweden	<b>Battery-operated toy dog</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have excessive concentrations of lead (measured value up to 37% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/01997/25	Germany	<b>Climbing frame</b>  (Country of Origin: <b>Poland</b> )		<b>Strangulation</b> The climbing set has accessible openings through which the child could fall or in which the child's head could become trapped. This could lead to strangulation. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-8.	Recall of the product from end users

SR/01998/25	Czechia	<b>Plastic doll</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The plastic material of the toy has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 23.03% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Stop of sales
SR/02001/25	Czechia	<b>Plastic doll</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 25.60% by weight). This phthalate may harm the health by causing possible damage to the reproductive system. The product does not comply with the REACH Regulation.	Stop of sales
SR/02002/25	Czechia	<b>Plastic doll</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured values up to 25.55% by weight). This phthalate may harm the health by causing possible damage to the reproductive system. The product does not comply with the REACH Regulation.	Stop of sales
SR/02013/25	France	<b>Colouring set</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has small parts (cap of the felt-tip pen and foam cushion) which may easily detach. A child may put them into their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/02021/25	Poland	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> Small parts can detach easily (eyes, ball chains). A child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Import rejected at border



SR/02035/25	Czechia	<b>Plastic doll</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b>  The plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 8.47% by weight). This phthalate may harm the health by causing possible damage to the reproductive system. The product does not comply with the REACH Regulation.	Stop of sales
-------------	---------	---	---	--	---------------

## Safety Gate: the EU rapid alert system for dangerous non-food products



“Safety Gate”, the EU rapid alert system (formerly known as “RAPEX”), enables the rapid exchange of information between **31 European countries** and the European Commission on non-food dangerous products found on the market posing a risk to the health and safety of consumers.


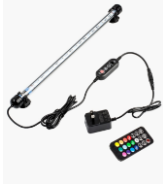
A weekly overview of the alerts on those products is published in English for free on <https://ec.europa.eu/safety-gate-alerts/screen/search?resetSearch=true>. The measures taken in the notifying country in order to restrict such products’ marketing or use can be ordered by national authorities (“compulsory measures”) or be taken directly by producers and distributors (“voluntary measures”).


The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 of the General Product Safety Directive (**2001/95/EC**) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.


## Recall Summary – US Toys / Children’s Products


**CPSC Recall List (May 2025)**



Recall No.	Notifying Country	Product	Product Photo	Hazard / Risk	Remedy
25-245	USA	<b>Dlesot Snap Hair Clips</b>  (Country of Origin: <b>China</b> )		<p><b>Poisoning Hazard</b></p> <p>Dlesot Snap Children’s Hair Clips Recalled Due to Lead Poisoning Hazard; Violation of Federal Ban for Lead in Paint; Sold Exclusively on Amazon by YFLGOTOO</p> <p>The painted hair clips contain levels of lead that exceed the federal lead paint ban, posing a lead poisoning hazard to children. Lead is toxic if ingested by young children and can cause adverse health issues.</p>	<p>Consumers should immediately take the recalled hair clips away from children, stop using them and contact YFLGOTOO.</p> <p>Consumers will need to provide a picture of disposal, to receive the remedy. Amazon is contacting all known purchasers directly.</p>
25-252	USA	<b>Xylolin Peg Doll Toy Sets</b>  (Country of Origin: <b>China</b> )		<p><b>Choking Hazard</b></p> <p>Xylolin Peg Doll Toy Sets Recalled Due to Risk of Serious Injury or Death from Choking Hazard; Violation of Federal Regulations for Toys; Sold Exclusively on Amazon.com by Babywants</p> <p>The peg dolls’ spherical ends can block the child’s airway, posing a risk of choking and death to children.</p>	<p>Consumers should take the product away from children immediately, dispose of the product and send a picture to Babywants for a full refund. Amazon is contacting all known purchasers directly.</p>


25-278	USA	<p><b>Boyro Baby Convertible High Chairs</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Fall and Entrapment Hazards</b></p> <p>Boyro Baby Recalls High Chairs Due to Risk of Serious Injury or Death from Fall and Entrapment Hazards; Violations of Federal Regulations for High Chairs; Sold Exclusively on Amazon.com</p> <p>The high chairs pose a deadly fall hazard to babies because the restraint system is not attached to the product and the locks or latches can fail. In addition, the high chairs pose an entrapment hazard because the opening between the seat and tray is large enough that a child can become entrapped in it. These are violations of the federal regulations for high chairs.</p>	<p>Consumers should stop using and disassemble the recalled high chairs immediately and contact Boyro Baby for instructions on receiving a full refund. The instructions will include instructions on cutting the restraint system and seat cushions, and emailing photos of the disassembled and destroyed pieces of the high chair to boyrobaby@outlook.com. Once the photos have been received, Boyro Baby will issue a refund.</p>
25-279	USA	<p><b>NICREW 15" Submersible RGB LED Lights with remote controls</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Ingestion Hazard</b></p> <p>NICREW Submersible RGB LED Lights Recalled Due to Risk of Serious Injury or Death from Ingestion Hazard; Violations of Federal Regulations for Consumer Products with Coin Batteries; Sold on Amazon by Nicrew</p> <p>The Submersible RGB LED Light's remote control has a lithium coin battery that can be easily accessed by children, posing an ingestion hazard. This violates the mandatory federal regulations for consumer products containing button cell or coin batteries. In addition, the recalled products do not have the required warnings. When button cell or coin batteries are swallowed, the ingested batteries can cause serious injuries, internal chemical burns and death.</p>	<p>Consumers should immediately stop using the recalled product, remove the battery from the remote control and place it in an area that children cannot access. Contact Nicrew for a free replacement of the remote and information on how to properly dispose of the product. Consumers need to email the Amazon order number and a photo showing the remote was destroyed by the consumer to nicrew@support.com to obtain the replacement. Nicrew and Amazon are contacting all known purchasers directly.</p> <p>Note: Button cell and coin batteries are hazardous. These batteries should be disposed of or recycled by following local hazardous waste procedures.</p>

25-280	USA	<p><b>Digital Wall Clocks</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Ingestion Hazard</b></p> <p>Leon Rading Recalls Digital Wall Clocks Due to Risk of Serious Injury or Death from Ingestion Hazard; Violations of Federal Regulations for Consumer Products with Coin Batteries; Sold Exclusively on Amazon.com</p> <p>The recalled digital wall clocks violate the mandatory federal regulations for consumer products containing button cell or coin batteries. The remote control for the clock has a lithium coin battery that can be easily accessed by children, posing an ingestion hazard. In addition, the recalled products do not have the warnings required under Reese’s Law. When button cell or coin batteries are swallowed, the ingested batteries can cause serious injuries, internal chemical burns and death.</p>	<p>Consumers should immediately stop using the recalled digital wall clock’s remote control, remove the lithium coin battery from the remote and dispose of or recycle it in accordance with local hazardous waste procedures. Consumers should write “RECALLED” in permanent marker on the remote and then email a photo of the remote being disposed of in the trash to <a href="mailto:recall@lianaocoltd.com">recall@lianaocoltd.com</a> to receive a full refund for the recalled digital clock. Leon Rading and Amazon are contacting all known purchasers directly.</p> <p>Note: Button cell batteries are hazardous. Batteries should be disposed of or recycled by following local hazardous waste procedures.</p>
--------	-----	--	---	--	---



25-281	USA	<p><b>PlayTab Rollers Tile Toys</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Ingestion Hazard</b></p> <p>Fat Brain Recalls Rollers Tile Toys Used in PlayTab Modular Activity Boards Due to Magnet Ingestion Hazard; Risk of Serious Injury or Death; Violation of Federal Regulations for Toy Magnets</p> <p>The recalled rollers tile toy violates the mandatory federal regulation for toy magnets because it contains a magnet that can become loose, posing an ingestion hazard to children. When high-powered magnets are swallowed, the ingested magnets can attract each other, or other metal objects, and become lodged in the digestive system. This can result in perforations, twisting, and/or blockage of the intestines, infection, blood poisoning, and death.</p>	<p>Consumers should stop using the rollers tile toys immediately and contact the firm for instructions on how to dispose of the product to obtain a \$10 credit for use at <a href="http://fatbraintoy.com">fatbraintoy.com</a>, or a replacement PlayTab tile. Fat Brain Toy Co. is contacting all known purchasers directly.</p>
--------	-----	--	---	--	--

25-285	USA	<p><b>Chill Pill Magnetic Haptic Fidget Toys Red Bumpy</b></p> <p>(Country of Origin: <b>United States</b>)</p>		<p><b>Ingestion Hazard</b></p> <p>FidgetThings Recalls Chill Pill Magnetic Haptic Fidget Toys Red Bumpy Due to Risk of Serious Injury or Death from Ingestion; Violation of Federal Regulations for Magnets; Sold Exclusively on FidgetThings.com</p> <p>The recalled magnetic fidget pill toy violates the mandatory federal regulation for magnets, posing an ingestion hazard to children.</p> <p>When high-powered magnets are swallowed, the ingested magnets can attract to each other, or another metal object, and become lodged in the digestive system. This can result in perforations, twisting and/or blockage of the intestines, infection, blood poisoning and death.</p>	<p>Consumers should stop using the magnetic fidget pill toys immediately and take them away from children. Contact FidgetThings via email at <a href="mailto:fidgetthings@gmail.com">fidgetthings@gmail.com</a> to receive a pre-paid label to return the toy, or for instructions on how to dispose of the toy, to receive a full refund. FidgetThings is notifying all known purchasers directly.</p>
--------	-----	---	---	--	---



25-286	USA	<p><b>Child Safety Gates</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Entrapment and Fall Hazards</b></p> <p>Child Safety Gates Recalled Due to Risk of Serious Injury or Death from Entrapment and Fall Hazards; Violations of Federal Regulation for Gates and Enclosures; Imported by Yiwu Baili Import and Export; Sold on Amazon.com</p> <p>The recalled child safety gates violate the federal safety regulation for expansion gates and expandable enclosures because a child's torso can fit through the opening between the gate slat and side wall, a child's torso can fit through the secondary opening, the locking mechanism does not fully engage and/or the gate does not resist a push-out force. These failures pose a risk of serious injury or death due to entrapment and fall hazards.</p>	<p>Consumers should stop using the recalled gates immediately and contact the third-party seller by email for information on how to dispose of the product and submit proof of destruction to obtain a full refund. The third-party sellers and Amazon are contacting all known purchasers directly.</p>
25-287	USA	<p><b>Children's Mini Danica Loungewear Sets</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Burn Hazard</b></p> <p>BuddyLove Recalls Children's Mini Danica Loungewear Sets Due to Risk of Serious Injuries or Death from Burn Hazard; Violation of Federal Regulations for Children's Sleepwear</p> <p>The recalled children's pajama sets violate flammability standards for children's sleepwear, posing a burn hazard and risk of serious injuries or death to children.</p>	<p>Consumers should stop using the recalled pajamas immediately and contact BuddyLove for information on how to dispose of the product to obtain a full refund or store credit for the original purchase price. Consumers should destroy the garments by cutting them in half and email a photo of the destroyed garment to Recall@buddylove.com. Upon receipt of the photo, consumers will be issued a full refund of the purchase price. BuddyLove is contacting all known purchasers directly.</p>

25-290	USA	<p><b>Nezmdi Baby Swings</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Suffocation Hazard</b></p> <p>Nezmdi Infant Swings Recalled Due to Risk of Serious Injury or Death from Suffocation Hazard; Multiple Federal Safety Violations; Sold Exclusively on Amazon.com by Nezmdi</p> <p>The swings pose a suffocation hazard and a risk of serious injury or death to babies, because they were marketed for infant sleep and have an incline angle greater than 10 degrees, in violation of the Safe Sleep for Babies Act. The swings also fail to meet the mandatory warning requirements under the swing regulations. In addition, the remote control included with the swings contains a lithium coin battery and is missing the required warnings and instructions for consumer products containing button cell and coin batteries under Reese’s Law.</p>	<p>Consumers should stop using the recalled infant swings immediately and contact Nezmdi for a full refund. Consumers should send a photo of the swing cover cut in half with “Recalled” written with permanent marker on its base to <a href="mailto:yingpengds@163.com">yingpengds@163.com</a>, and then dispose of the swing in accordance with state and local procedures. Nezmdi is contacting all known purchasers directly.</p> <p>Note: Button cell and coin batteries are hazardous. Batteries should be disposed of or recycled by following local hazardous waste procedures.</p>
--------	-----	---	---	--	--



25-291	USA	<p><b>Holiday Lane Infant Footed Pajamas</b></p> <p>(Country of Origin: <b>Vietnam</b>)</p>		<p><b>Injury Hazard</b></p> <p>Macy's Recalls Holiday Lane Infant Footed Pajamas Due to Injury Hazard; Sold Exclusively by Macy's</p> <p>The elastic on the pajamas' ankles can be too tight and restrict blood circulation, posing an injury hazard.</p>	<p>Consumers should immediately stop using the recalled pajamas, take them away from children and contact Macy's for instructions on how to receive a refund. Consumers should not return the recalled pajamas to the stores. Consumers will be asked to fill out the recall form at <a href="https://www.recallrtr.com/footedpajamas">https://www.recallrtr.com/footedpajamas</a>. Once consumers fill out the recall form, they will be sent a pre-addressed, postage-paid envelope to return the footed pajamas free of charge. Macy's will issue a \$26.50 refund via check upon receipt of the recalled product. Macy's is contacting all known purchasers directly.</p>
25-292	USA	<p><b>Rolanstar 6-Drawer Dressers</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Tip-Over and Entrapment Hazards</b></p> <p>Areson Recalls Rolanstar 6-Drawer Dressers Due to Risk of Serious Injury or Death from Tip-Over and Entrapment Hazards; Multiple Violations of Federal Regulations for Clothing Storage Units; Sold Exclusively on Amazon.com</p> <p>The recalled dressers are unstable if they are not anchored to the wall, posing serious tip-over and entrapment hazards that can result in injuries or death to children. The dressers violate the performance requirements of the STURDY Act because they can tip over with fewer than 60 pounds applied horizontally, and the dressers also fail to meet the labeling requirements of the STURDY Act.</p>	<p>Consumers should stop using the recalled dressers immediately if they are not anchored to the wall and place them in an area that children cannot access. Areson, through Amazon Logistics Service, is contacting all known purchasers directly. Contact Areson for instructions on how to receive a full refund and how to submit a photo showing the disposal of the product to the firm at <a href="mailto:Support@Areson.shop">Support@Areson.shop</a>.</p>

25-293	USA	<p><b>Sivan Six-Drawer Double Dressers</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Tip-Over and Entrapment Hazards</b></p> <p>Sivan Dressers Recalled Due to Risk of Serious Injury or Death from Tip-Over and Entrapment Hazards; Multiple Violations of Federal Regulations for Clothing Storage Units; Sold on Wayfair.com by Anji Guyou Furniture</p> <p>The recalled dressers are unstable if they are not anchored to the wall, posing serious tip-over and entrapment hazards that can result in injuries or death to children. The dressers violate the performance requirements of the STURDY Act because they can tip over with fewer than 60 pounds applied horizontally, and the dressers also fail to meet the labeling requirements of the STURDY Act.</p>	<p>Consumers should immediately stop using the recalled dressers if they are not anchored to a wall and place them in an area that children cannot access. Consumers can contact Anji Guyou Furniture for instructions on how to dispose of the dressers to receive a full refund. Consumers must email a photo showing disposal of the product to <a href="mailto:guyouproductrecall@163.com">guyouproductrecall@163.com</a>. Anji Guyou Furniture and Wayfair are also contacting all known purchasers directly.</p>
25-294	USA	<p><b>DTR Plush Bag Stitch and DTR Plush Bag Angel</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Choking and Ingestion Hazards</b></p> <p>Primark Recalls DTR Plush Bag Stitch and DTR Plush Bag Angel Due to Choking and Ingestion Hazards</p> <p>The zipper pull on the back of the plush bags can detach, posing a risk of serious injury or death from choking and/or ingestion of the zipper pull.</p>	<p>Consumers should immediately take the recalled plush bags away from children, stop using them and return them to a Primark store for a full refund in the form of the original payment.</p>

25-303	USA	<p><b>Unity Teeter Tunnels with Lexan Tops</b></p> <p>(Country of Origin: <b>United States</b>)</p>		<p><b>Injury and Crush Hazard</b></p> <p>Playworld Systems Recalls Unity Teeter Tunnels with Lexan Tops Due to Risk of Serious Injury and Crush Hazard</p> <p>If a child accidentally falls underneath the Unity Teeter Tunnel, the end of the seesaw plank can land on them, posing a risk of serious injury and a crush hazard.</p>	<p>Consumers should immediately stop using the recalled teeter tunnels and contact Playworld Systems to schedule a free repair. Playworld Systems will send a certified playground installer to each location to repair the unit. Playworld Systems is contacting all known purchasers directly and will request that consumers place the teeter tunnels out of service until the repair is completed.</p>
25-308	USA	<p><b>My First Snowman Toys</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Choking Hazard</b></p> <p>The Step2 Company Recalls My First Snowman Toys Due to Risk of Serious Injury or Death from Choking Hazard</p> <p>The top hat on the recalled snowman can break into small pieces, posing a risk of serious injury or death to small children from choking.</p>	<p>Consumers should stop using the recalled snowman immediately, take off the toy snowman's hat and keep it away from children. Contact The Step2 Company for instructions on how to dispose of the top hat and receive a free replacement. The Step2 Company is notifying all known purchasers directly.</p>

\* Source: [www.recalls.gov](http://www.recalls.gov)


## CPSC

The United States Consumer Product Safety Commission (CPSC) is an independent agency of the United States Government. To provide better service in alerting the American people to unsafe, hazardous or defective products, a “one stop shop” for U.S. Government recalls, <http://www.recalls.gov>, has been created. Members of the public may report unsafe products to CPSC by using the platform.


The recall list is divided into seven categories: Consumer Products, Motor Vehicles, Boats, Food, Medicine, Cosmetics and Environmental Products. Generally, the recall is conducted voluntarily by the company under CPSC's Fast Track Recall program. Fast Track recalls are initiated by firms who are committed to working with CPSC to quickly announce the recall and remedy to protect consumers.


## Recall Summary – Australia Toys / Children’s Products


**ACCC Recall List (May 2025)**

PRA No.	Notifying Country	Product / Description	Product Photo	Hazard / Risk	Remedy
2025/20498	Australia	<p><b>SHEIN EVRYDAY Kids’ pyjama sets</b></p> <p><b>SHEIN Distribution Australia Pty Ltd.</b></p>		<p><b>Risk of Serious Burn or Injuries</b></p> <p>The product does not comply with the mandatory standard for nightwear for children.</p> <p>It does not include the required warning label.</p> <p>There is a risk of serious burn injuries if exposed to a heat or flame source.</p> <p>Consumers may not be aware of this risk.</p>	<p>Consumer should stop using the product immediately.</p> <p>SHEIN will be contacting affected consumers via email with a link to confirm disposal of the product.</p> <p>SHEIN will process a full refund when the email is actioned.</p> <p>Contact SHEIN if you have not received the email or are having difficulties with the email.</p> <p>Contact: SHEIN Distribution Australia Pty Ltd.</p> <p>Email: <a href="mailto:aucsteam@shein.com">aucsteam@shein.com</a></p> <p>Live chat 11:00am to 8:00pm AEST.</p>


2025/20491	Australia	<p><b>Tissue box toy component of 3-in-1 activity centre.</b></p> <p><b>Model: HLV78</b></p>		<p><b>Risk of Serious Injury or Death</b></p> <p>The detachable tissue box toy can come apart, exposing the small support brackets to young children.</p> <p>There is a risk of serious injury or death by choking if the child places the small parts in their mouth.</p> <p>Two reports worldwide of the tissue box toy coming apart have been received. No incidents have occurred in Australia. No injuries have been reported.</p>	<p>Remove the tissue box toy from the activity centre immediately and place out of reach of children.</p> <p>Contact Mattel Consumer Relations for information on how to return the tissue box and receive a free replacement toy for the activity centre.</p> <p>Contact Mattel Pty Ltd</p> <p>Email: <a href="mailto:infoaust@mattel.com">infoaust@mattel.com</a></p> <p>Call: 1300 135 312 10:00am to 7:00pm AEST Monday to Friday</p>
------------	-----------	--	---	---	---



2025/20500	Australia	<b>Zelda light up sword</b>		<p><b>Missing of Warnings</b></p> <p>The product does not comply with the mandatory standards for products containing button/coin batteries.</p> <p>The button/coin batteries are not adequately secured and are accessible by young children.</p> <p>The product does not include the required warning information.</p> <p>Risk of choking, severe internal burn injuries or death to young children if they gain access to the button/coin batteries and swallow them or place them inside their body.</p> <p>Severe or fatal injuries can happen in 2 hours or less.</p> <p>Consumers may be unaware that the product contains button batteries.</p>	<p>Stop using the product and keep it out of reach of children.</p> <p>Return the sword to your local EB Games store for a full refund.</p> <p>Contact: EB Games</p> <p>Email: <a href="mailto:customer.service@ebgames.com.au">customer.service@ebgames.com.au</a></p> <p>Call: 07 4800 4084 8:00 am to 4:00 pm Monday to Friday</p>
------------	-----------	-----------------------------	---	---	---



2025/20501	Australia	<p><b>Happy Easter White Rabbit Hoodie, Size 6-8 Years</b></p> <p><b>Spotlight Pty Ltd</b></p>		<p><b>Fire Hazard</b></p> <p>The product does not comply with the mandatory standard for nightwear for children.</p> <p>The product does not have the required fire hazard label.</p> <p>There is a risk of serious burn injuries if exposed to a heat or flame source.</p> <p>Consumers may not be aware of this risk.</p>	<p>Stop using the product immediately and keep out of reach of children.</p> <p>Return the product to a Spotlight store for a refund. No receipt required.</p> <p>Send Spotlight an email or call Spotlight if you are unable to return the product or have sold or gifted it to another person.</p> <p>Contact Spotlight Pty Ltd</p> <p>Call: 1300 305 405</p> <p>Web: <a href="http://www.spotlightstores.com/contact-us">www.spotlightstores.com/contact-us</a></p>
------------	-----------	--	---	---	--

<p>2025/20502</p>	<p>Australia</p>	<p><b>Snowman doll with removable components including a top hat, ears, mittens and faces.</b></p> <p><b>Affected models are identifiable by the date code "12/2023" or "04/2024" located on the bottom of the top hat component. See photos.</b></p>		<p><b>Risk of Serious Injury or Death</b></p> <p>This product does not comply with the mandatory standard for toys for children up to and including 36 months of age.</p> <p>The top hat may break and create small parts.</p> <p>Risk of serious injury or death from choking if a child swallows a small part from the broken toy.</p>	<p>Stop using the product immediately and dispose the original top hat component. Contact Step 2 Direct Australia using the contact details below to order a replacement top hat component. Send an email to or phone Little Smiles Pty Ltd if you have sold or gifted the product to another person.</p> <p>Contact: Step2 Direct Australia</p> <p>Email: <a href="mailto:info@littlesmiles.com.au">info@littlesmiles.com.au</a></p> <p>Call: 1300 665 882 from 9:00am to 5:00pm AEST Monday to Friday</p>
-------------------	------------------	---	---	--	---



2025/20503	Australia	<p><b>Highchair with baby set accessory from 6 months to 36 months old and from 36 months old up to 100kg without the baby set.</b></p> <p><b>Model numbers:</b>  <b>200001013,</b>  <b>200001001,</b>  <b>200001002,</b>  <b>200001005,</b>  <b>200001007.</b></p>		<p><b>Risk of Serious Injury from Falling</b></p> <p>The screws connecting the legs to the frame can become loose and may detach when a baby or toddler is seated with or without the baby set accessory of the highchair.</p> <p>Risk of serious injury from falling if the chair detaches from the frame while in use.</p> <p>There have been incidents and an injury involving babies.</p>	<p>Stop using the highchair immediately. Contact Bugaboo to register your details for a repair kit to be sent via <a href="https://service.bugaboo.com/s/bugaboo-giraffe-repair-kit-checker">https://service.bugaboo.com/s/bugaboo-giraffe-repair-kit-checker</a>.</p> <p>Replace the current screws with the redesigned screws using the improved Allen key and following the step-by-step instruction manual in the repair kit.</p> <p>Contact: Bugaboo International B.V.</p> <p>Email: <a href="mailto:service.au@bugaboo.com">service.au@bugaboo.com</a></p> <p>Call: 02 7908 7089 9:00 am to 5:00 pm Monday to Friday.</p>
------------	-----------	---	---	---	--

2025/20504	Australia	<p><b>CHWRBOTTLEPRO</b></p> <p><b>Colour: White</b></p> <p><b>Look for the product label on the underside of the bottle warmer to see if it is CHWRBOTTLEPRO</b></p>		<p><b>Risk of Serious Injury</b></p> <p>The bottle warmer may overheat whilst charging or while in use.</p> <p>Risk of serious injury, death or property damage if the bottle warmer overheats and catches fire. An incident has occurred.</p>	<ol style="list-style-type: none"> <li>1. Stop using the product immediately.</li> <li>2. Visit Cherub Baby's recall page to check if your warmer is affected and arrange for a replacement warmer free of charge.</li> </ol> <p>Contact : Cherub Baby</p> <p>Email: mail@cherubbaby.com.au (03) 9005 1734 9am to 4pm Monday to Friday</p>
2025/20519	Australia	<p><b>Timeless 3-in-1 pram designed for infants and toddlers. Converts between a carrycot, seat, and capsule.</b></p>		<p><b>Risk of Serious Injury or Death</b></p> <p>This stroller does not comply with the mandatory standard for prams and strollers.</p> <p>The brake control is not red and it is missing required warning labels.</p> <p>Risk of serious injury or death to babies or young children due to the missing safety features.</p>	<p>Stop using these strollers immediately.</p> <p>Contact Baby Boujee at hello@babyboujee.com with your order number and product details to arrange a refund.</p> <p>Provide photo evidence to Baby Boujee of the product destroyed and discarded.</p> <p>Contact Baby Boujee if you need further assistance at hello@babyboujee.com</p> <p>Contact: Baby Boujee</p> <p>Email: <a href="mailto:hello@babyboujee.com">hello@babyboujee.com</a></p> <p>Call: 0456 180 400</p>

<p>2025/20524</p>	<p>Australia</p>	<p><b>Various baby products</b> <b>Baby Boujee</b></p>		<p><b>Risk of Serious Injury or Death</b></p> <p>The rattles, soft toys and musical fun set products do not comply with the mandatory standard for toys for children up to and including 36 months of age.</p> <p>The Ducky Sip 'n Learn Cup may liberate small parts if small pieces of silicone separate from the product.</p> <p>Risk of serious injury or death from choking if a young child put small or dislodged parts into their mouth.</p>	<p>Consumers should stop using the product immediately and place out of reach of children. Contact Baby Boujee via email or call 0456 180 400 for a full refund and to provide proof of destruction of the product.</p> <p>Contact: Baby Boujee</p> <p>Email: <a href="mailto:hello@babyboujee.com">hello@babyboujee.com</a></p> <p>Call 0456 180 400 between 9:00am and 5:00pm AEST, Monday to Friday</p>
<p>2025/20532</p>	<p>Australia</p>	<p><b>Fat Brain rollers tile sold in a set of three as part of the Playtab Sensory Set 3. The tile has blue, red and green rubberized and textured rollers</b></p>		<p><b>Risk of Serious Internal Injuries or Death</b></p> <p>The product does not comply with the mandatory safety standard for toys containing magnets.</p> <p>The magnets can become loose during use.</p> <p>Risk of serious internal injuries or death if a child swallows more than one high-powered magnet as they stick together in the child's intestine or other digestive tissue. Risk of serious injury or death from choking.</p>	<p>Consumers should stop using the product immediately and place out of reach of children. Contact TOMY who will provide a free replacement Playtab Tile to all affected consumers.</p> <p>Do not return the product to the store. Return the product to:</p> <p>TOMY Australia Reply Paid 4460 Dandenong South VIC 3175</p> <p>Contact: TOMY Australia</p> <p>Email: <a href="mailto:serviceaus@tomy.com">serviceaus@tomy.com</a></p> <p>Phone: 03 9799 5500 9:00am to 3:00pm Monday to Friday</p>

### **Australian Product Safety System**

The Australian product safety system is set up to maximize the safety of goods through the cooperation of consumers, businesses and agencies. This policy sets out the principles adopted by the Australian Competition and Consumer Commission (ACCC) for prioritizing and addressing product safety risks.

Under the Australian Consumer Law, a responsible Minister can order a compulsory recall when there are hazards on the products. A voluntary recall could be conducted to remove the product from the marketplace when the suppliers become aware of unsafe or defective products.

The ACCC administers a national recalls system for recalls of specific and general consumer products, and publishes all product recalls on the website <https://www.productsafety.gov.au/recalls>.

## Recall Summary – Japan’s Toys / Children’s Products

### METI Recall List (May 2025)

PRA No.	Notifying Country	Product / Description	Product Photo	Hazard / Risk	Remedy
2025-05-29	Japan	玩具  Toy		星形パーツのミラー接着不良により、ミラーの剥落の恐れがあるため。  There is a risk of the mirror falling off due to poor adhesion of the star-shaped parts.	回収・修理（または交換） ※対象製品の星形パーツのみ  Collection and repair (or replacement) *Only star-shaped parts of the target products

### Japan’s Product Recall System (経済産業省リコール情報)

The METI (経済産業省 Ministry of Economy, Trade and Industry) administers a national recalls system for recalls of specific and general consumer products according to the Consumer Product Safety Act, and publishes all product recalls on the website: [https://www.meti.go.jp/product\\_safety/recall/index.html](https://www.meti.go.jp/product_safety/recall/index.html) and posting at <https://x.com/kochijiko>.

STC (Hong Kong Standards and Testing Centre) is a not-for-profit, independent testing, inspection and certification organization. With a global network of ISO/IEC 17025 accredited testing laboratories and over 60 years of experience in consumer product testing, we can meet your conformity assessment needs with highly efficient and reliable service. Our testing scope and capabilities related to toys and children's products include but are not limited to:

### EU Requirements

- EN 71
- Phthalates (EC) no. 1907/2006
- Nickel Release (EC) no. 1907/2006
- Total Cadmium (EEC) no. 91/338
- Lead in Jewellery product (EC) no. 836/2012
- Azo-dye (EC) no. 1907/2006
- Bisphenol-A (2014/81/EU)
- DMF (Dimethyl fumarate) (EU) no. 2011/135
- Flame retardants TCEP, TCPP, TDCP (2014/79/EU)
- Package Waste Directive (94/62/EC)

### US & Canada Requirements

- ASTM F963
- CPSIA
- California Proposition 65
- 16 CFR 1501
- ASTM F2923 (Children's jewellery)
- ASTM F2999 (Adult's jewellery)
- US Toxic in Packaging Clearinghouse (TPCH)
- CCPSA - Toys Regulations (SOR/2011-17)

### Japan Requirements

- Japan Toy Safety Standard (ST)
- Japan Food Sanitation Law (JFSL)

### Australia Requirements

- AS/NZS 8124
- Consumer Protection Notice No. 6 of 2010 - DEHP

#### FOR MORE DETAILS, PLEASE CONTACT US:

Hong Kong: [hktcd@stc.group](mailto:hktcd@stc.group)  
Changzhou: [czstc@stc.group](mailto:czstc@stc.group)  
U.S.A.: [usenquiry@stc.group](mailto:usenquiry@stc.group)

Guangdong: [gdtcd@stc.group](mailto:gdtcd@stc.group)  
Vietnam: [vnstc@stc.group](mailto:vnstc@stc.group)  
Germany: [grstc@stc.group](mailto:grstc@stc.group)

Shanghai: [shtcd@stc.group](mailto:shtcd@stc.group)  
Japan: [jpo@stc.group](mailto:jpo@stc.group)

