


Recall Summary – European Toys


EU Safety Gate Alerts (Jul 2025)





Alert No.	Notifying Country	Product	Product Photo	Hazard / Risk	Measures Adopted
OR/00111/25	Slovakia	Plastic toy (Country of Origin: China)		Choking The product has small parts (caterpillar spikes) that can easily detach. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Warning consumers of the risks
SR/02384/25	Finland	Balloons (Country of Origin: Poland)		Chemical The rubber of the balloons releases an excessive amount of nitrosamines (measured total value up to 1.78 mg/ kg). Nitrosamines may cause cancer through ingestion or dermal exposure. A child could be exposed to them when touching or putting the product in the mouth. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-12.	Ban on the marketing of the product and any accompanying measures
SR/02387/25	France	Fancy-dress costume (Country of Origin: China)		Chemical The migration of chromium VI from the toy is too high (measured value up to 0.26 mg/kg). Chromium (VI) is sensitising, can trigger allergic reactions and can cause cancer. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Withdrawal of the product from the market
SR/02388/25	Germany	Baby sleeping bag (Country of Origin: Vietnam)		Suffocation The neck area of the product is stretchy and can increase in circumference. As a result, the child may slip down into the sleep bag and suffocate. Moreover, the sleeping bag has a hood, which can cover their mouth and/or nose of the child and lead to suffocation. The product does not comply with the General Product Safety Regulation nor with the European standard EN 16781.	Warning consumers of the risks





SR/02394/25	Luxembourg	Battery-operated toy rabbit (Country of Origin: China)		Choking Small parts can easily detach (the eyes of the rabbit). As a consequence, a small child may put them in their mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive nor with the European standards EN 71-1 and EN 62115.	Import rejected at border
SR/02395/25	UK	Water mat (Country of Origin: China)		Suffocation The plastic of the packaging is too thin. If a child plays with it, the plastic can cover their mouth and nose, causing the child to suffocate. This product does not comply with the Toy Safety Directive.	Import rejected at border
SR/02409/25	Austria	Toy harmonica (Country of Origin: China)		Damage to hearing The sound pressure level and the peak sound pressure level produced by the toy are too high (measured value up to 110dB). This could lead to permanent or partial hearing loss. The product does not comply with the requirements of the Toy Safety Directive nor with European standard EN 71-1.	Recall of the product from end users
SR/02417/25	France	Fancy dress costume (Country of Origin: China)		Chemical The migration of chromium VI from the dress is too high (measured value up to 0.44 mg/kg). Chromium (VI) is sensitising, can trigger allergic reactions and can cause cancer. The product does not comply with the requirements of the Toy Safety Directive, the REACH Regulation nor with the European standard EN 71-3.	Recall of the product from end users
SR/02436/25	Austria	Toy trumpet (Country of Origin: China)		Damage to hearing The sound pressure level produced by the toy is too high (measured value up to 97.5 dB). This could lead to permanent or partial hearing loss. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users

SR/02458/25	Austria	Soft toy (Country of Origin: China)		Choking Small parts can easily detach (the eyes of the toy). As a consequence, a small child may put them in their mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/02461/25	Czechia	Plastic doll set (Country of Origin: China)		Chemical The plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 42.6% by weight). This phthalate may harm the health by causing possible damage to the reproductive system. The product does not comply with the REACH Regulation.	Destruction of the product
SR/02464/25	France	Watercolours (Country of Origin: China)		Chemical The migration of lead from the paint is too high (measured value up to 5.5 mg/kg). Lead is harmful to children as it can lead to developmental neurotoxicity. It accumulates in the body and may also affect their future progeny when breast-fed or unborn. The product does not comply with the Toy Safety Directive nor with the REACH Regulation or the European standard EN 71-3.	Recall of the product from end users
SR/02467/25	Finland	Toy hair braid (Country of Origin: Unknown)		Chemical The battery compartment can easily be opened without use of any tools and the button cell batteries inside are easily accessible. Children may put them in their mouth and swallow them, causing damage to their gastrointestinal tract. The product does not comply with the requirements of the Toy Safety Directive nor with European standard EN 62115.	Recall of the product from end users

SR/02475/25	UK	Playmat (Country of Origin: China)		Choking, Entrapment The detachable toys include fabric loops sewn into the side of one of the seams. The loops are large enough that a young child can easily insert their finger into them and twist, causing him to get trapped. The fibrous stuffing material of the star toy is easily accessible due to the weakness of certain seams. A small child may put the filling material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive.	Removal of this product listing by the online marketplace
SR/02479/25	Poland	Toy tricycle (Country of Origin: China)		Entrapment, Injuries The mechanical strength of the toy is inadequate, the toy may dismantle during use, leading to injuries. There are accessible gaps between moving parts of the tricycle. A child's leg may become trapped there and be injured. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/02483/25	Sweden	Night lamp (Country of Origin: China)		Environment The solders in the product have an excessive concentration of cadmium (measured value up to 0.17% by weight). Cadmium bio-accumulates and poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Stopping of sales
SR/02487/25	Austria	Beach toy set (Country of Origin: China)		Choking The toy contains small parts (shells). As a consequence, a small child may put them in their mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users






SR/02488/25	France	Pop it toy (Country of Origin: China)		Chemical The product contains an excessive amount of phthalates (in particular bis(2-ethylhexyl) phthalate (DEHP)) (measured value up to 1.8% by weight). Phthalates may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation nor with the requirements of the Toy Safety Directive.	Destruction of the product
SR/02491/25	France	Pop it toy (Country of Origin: China)		Chemical The product contains an excessive amount of phthalates (in particular bis(2-ethylhexyl) phthalate (DEHP)) (measured value up to 1.1% by weight). Phthalates may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation nor with the requirements of the Toy Safety Directive.	Recall of the product from end users
SR/02496/25	Austria	Toy revolver (Country of Origin: Thailand)		Damage to hearing The sound pressure level produced by the toy is too high (measured value up to 130.7 dB). This could lead to permanent or partial hearing loss. The product does not comply with the requirements of the Toy Safety Directive or the relevant European standard EN 71-1.	Recall of the product from end users
SR/02498/25	Austria	Expandable ball toy (Country of Origin: China)		Chemical, Choking The battery compartment can be easily opened/broken, leaving the button batteries accessible. A child may put them in their mouth and swallow them, which could cause damage to the child's gastrointestinal tract and/or choking. The product does not comply with the requirements of the Toy Safety Directive nor with European standards EN 71-1 and EN 62115.	Removal of this product listing by the online marketplace

SR/02500/25	Germany	Balloons (Country of Origin: China)		Chemical The rubber of the balloons releases an excessive amount of nitrosamines (measured value up to 0.52 mg/kg) and nitrosatable substances (4.73 mg/kg). Nitrosamines may cause cancer through ingestion or dermal exposure. A child could be exposed to them when touching or putting the product in the mouth. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-12.	Withdrawal of the product from the market
SR/02501/25	France	Toy sword (Country of Origin: China)		Chemical, Choking The battery compartment can be easily opened/broken, leaving the button batteries accessible. A child may put them in their mouth and swallow them, which could cause damage to the child's gastrointestinal tract and/or choking. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 62115.	Withdrawal of the product from the market
SR/02508/25	Spain	Folding seat (Country of Origin: China)		Choking The padding material can easily break, releasing small parts. Small children may put them in their mouth and choke. The product does not comply with the General Product Safety Regulation nor with the European standard EN 16120.	Ban on the marketing of the product and any accompanying measures
SR/02514/25	Slovakia	Battery powered toy (Country of Origin: China)		Choking The toy has small parts (the wheels) that can easily detach. A small child could put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users

SR/02518/25	France	Pistol crossbow toy (Country of Origin: China)		Choking The product has small parts (the arrows' suction cups) which may easily detach. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/02521/25	Austria	Plastic toy (Country of Origin: China)		Choking The toy contains small parts (eyes) that can be easily detached. Small children may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/02524/25	France	Key ring with soft toy (Country of Origin: China)		Choking The toy has small parts (keychain) which may easily detach. A child may put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Warning consumers of the risks
SR/02525/25	France	Toy bubble gun (Country of Origin: China)		Burns, Chemical, Choking The battery compartment can be easily opened without use of any tools and the button cell batteries inside are easily accessible. Children may put them in their mouth and swallow them, causing damage to their gastrointestinal tract. In addition, the toy's rear protection can be easily removed, allowing the live parts to heat up if they are brought into contact with a metallic object and causing burns to the user. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 62115.	Withdrawal of the product from the market
SR/02533/25	Croatia	Balloons (Country of Origin: Spain)		Chemical The rubber of the balloons releases an excessive amount of nitrosamines and nitrosatable substances (measured total value up to 0.073 mg/ kg). Nitrosamines may cause cancer through ingestion or dermal exposure. A child could be exposed to them when touching or putting the product in the mouth. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-12.	Withdrawal of the product from the market

SR/02535/25	Croatia	Balloons (Country of Origin: Spain)		Chemical The rubber of the balloons releases an excessive amount of nitrosamines and nitrosatable substances (measured total value up to 0.072 mg/kg). Nitrosamines may cause cancer through ingestion or dermal exposure. A child could be exposed to them when touching or putting the product in the mouth. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-12.	Ban on the marketing of the product and any accompanying measures
SR/02544/25	Lithuania	Plastic doll (Country of Origin: China)		Chemical The plastic material of the toy has an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 2.52% by weight). This phthalate may harm the health of children by causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Withdrawal of the product from the market
SR/02548/25	Czechia	Plastic doll (Country of Origin: China)		Chemical The plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 63.5% by weight). This phthalate may harm health by causing possible damage to the reproductive system. The product does not comply with the REACH Regulation.	Withdrawal of the product from the market
SR/02556/25	Austria	Toy revolver (Country of Origin: Thailand)		Damage to hearing The sound pressure level produced by the toy is too high (measured value up to 133.7 dB). This could lead to permanent or partial hearing loss. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/02562/25	France	Soft toy (Country of Origin: China)		Choking Small parts can easily detach (zipper pull). A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market




SR/02570/25	The Netherlands	Drawing board (Country of Origin: China)		Chemical, Choking The battery compartment can be easily opened, leaving the button batteries accessible. A child may put them in their mouth and swallow them, which could cause damage to the child's gastrointestinal tract and/or choking. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71.	Withdrawal of the product from the market
SR/02585/25	Croatia	Balloons (Country of Origin: Spain)		Chemical The rubber of the balloons releases an excessive amount of nitrosamines and nitrosatable substances (measured value 0.076 mg/kg). Nitrosamines may cause cancer through ingestion or dermal exposure. A child could be exposed to them when touching or putting the product in the mouth. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-12.	Withdrawal of the product from the market
SR/02593/25	Latvia	Board game (Country of Origin: China)		Choking The product consists of small parts. Small children may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive.	Import rejected at border
SR/02610/25	Germany	Toy slime set (Country of Origin: China)		Chemical The migration of boron from the toy slime is too high (measured value up to 3240 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Removal of this product listing by the online marketplace

SR/02613/25	Germany	Toy slime (Country of Origin: China)		Chemical The migration of boron from the toy slime is too high (measured value up to 3000 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Destruction of the product
SR/02623/25	Slovakia	Crib toy (Country of Origin: Unknown)		Choking The toy has small parts (legs, bodies and heads of the teddy bears) that can easily detach. A child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Stopping of sales
SR/02625/25	Slovakia	Plastic ball (Country of Origin: Unknown)		Choking The toy has a small part (squeaker element) that can easily detach. A child may put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Ban on the marketing of the product and any accompanying measures
SR/02626/25	Slovakia	Playmat (Country of Origin: China)		Choking The product has small parts (the eyes of the turtle, lion, fish, seahorse, penguin and horse) that can easily detach. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/02627/25	Slovakia	Toy military set (Country of Origin: China)		Choking The product has small parts that can easily detach (suction cups and projectiles). A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the European standard EN 71-1.	Warning consumers of the risks

SR/02630/25	Slovakia	Playmat (Country of Origin: Germany)		Suffocation The product has small parts (red piece- dog bangs and green piece - dog tongue) that can easily detach. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/02642/25	Spain	Key ring with toy (Country of Origin: China)		Choking The toy has small parts (keychain) that can easily detach. A child may put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/02643/25	Germany	Toy rattle (Country of Origin: Unknown)		Choking The toy has small detachable parts. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive.	Withdrawal of the product from the market
SR/02648/25	Germany	Toy slime (Country of Origin: Unknown)		Chemical The migration of boron from the toy slime is too high (measured value up to 894 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Removal of this product listing by the online marketplace
SR/02652/25	France	Toy rings (Country of Origin: China)		Chemical The plastic material of the product has an excessive concentration of diisobutyl phthalate (DIBP) and dibutyl phthalate (DBP) (measured values up to 2.25% and 1.05% by weight, respectively). These phthalates may harm the health by causing possible damage to the reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Withdrawal of the product from the market

SR/02674/25	UK	Water balloons (Country of Origin: China)		Injuries The toy has small parts (magnets) with a high magnetic flux, which can be easily detached from the balloon. A child may put the magnets in their mouth and swallow them, which may lead to them attracting one another, causing intestinal blockage or perforation. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace
SR/02679/25	UK	Light up toy (Country of Origin: China)		Chemical, Choking, Injuries The battery compartment can be easily opened, leaving the button batteries accessible. A child may put them in their mouth and swallow them, which could cause damage to the child's gastrointestinal tract and/or choking. The product does not comply with the requirements of the Toy Safety Directive.	Removal of this product listing by the online marketplace
SR/02693/25	Poland	Plastic doll (Country of Origin: China)		Chemical The plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 26.2% by weight). This phthalate may harm the health by causing possible damage to the reproductive system. The product does not comply with the REACH Regulation.	Withdrawal of the product from the market
SR/02709/25	Croatia	Toy slime (Country of Origin: China)		Chemical The migration of boron from the toy slime is too high (measured value up to 3180 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with European standard EN 71-3	Destruction of the product
SR/02716/25	Germany	Toy slime kit (Country of Origin: China)		Chemical The migration of boron from the toy slime is too high (measured value up to 3260 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Withdrawal of the product from the market

SR/02717/25	Slovakia	Playmat (Country of Origin: Vietnam)		Choking The toy has small parts that can easily detach (plane's window, excavator's wheels). A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/02723/25	Lithuania	Musical toy (Country of Origin: China)		Choking The product has small parts (small balls and butterflies) that can easily detach. Small children may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/02745/25	UK	Soft toy (Country of Origin: China)		Choking Small parts can easily detach (the eyes of the rabbit). As a consequence, a small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive.	Import rejected at border
SR/02746/25	UK	Expandable toy (Country of Origin: China)		Choking, Injuries The product expands more than 50% in size when in contact with water. If a child puts it in their mouth or swallows it, the contact with saliva or stomach liquids will cause the figurine to expand, which can result in occlusion of the respiratory track or intestinal blockage. The product does not comply with the requirements of the Toy Safety Directive.	Import rejected at border
SR/02748/25	UK	Bath toy (Country of Origin: China)		Choking Small plastic parts (inside the toy) may easily detach from the toy when filled with water and squeezed. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive.	Recall of the product from end users

SR/02754/25	UK	Remote-controlled toy car (Country of Origin: China)		Chemical The product's USB charging cable contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP), diisobutyl phthalate (DIBP) and dibutyl phthalate (DBP) (measured values up to 4.6%, 0.053% and 0.74% by weight, respectively). These phthalates may harm the health of children, causing possible damage to the reproductive system. The product does not comply with the REACH Regulation nor with the requirements of the Toy Safety Directive.	Destruction of the product
SR/02755/25	UK	Toy car (Country of Origin: China)		Choking The toy can easily break producing small parts. Small children may put them in their mouth and choke. This product does not comply with the requirements of the Toy Safety Directive.	Destruction of the product
SR/02763/25	Croatia	Balloons (Country of Origin: Poland)		Chemical The rubber of the balloons releases an excessive amount of nitrosamines (measured value up to 0.172 mg/kg). Nitrosamines may cause cancer through ingestion or dermal exposure. A child could be exposed to them when touching or putting the product in the mouth. Moreover, the rubber of the balloons releases an excessive amount of nitrosatable substances (measured value up to 2.63 mg/kg), which generate nitrosamines. The product does not comply with the requirements of the Toy Safety Directive.	Ban on the marketing of the product and any accompanying measures

Safety Gate: the EU rapid alert system for dangerous non-food products

“Safety Gate”, the EU rapid alert system (formerly known as “RAPEX”), enables the rapid exchange of information between **31 European countries** and the European Commission on non-food dangerous products found on the market posing a risk to the health and safety of consumers.

A weekly overview of the alerts on those products is published in English for free on <https://ec.europa.eu/safety-gate-alerts/screen/search?resetSearch=true>. The measures taken in the notifying country in order to restrict such products’ marketing or use can be ordered by national authorities (“compulsory measures”) or be taken directly by producers and distributors (“voluntary measures”).


The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 of the General Product Safety Directive (**2001/95/EC**) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.


Recall Summary – US Toys / Children’s Products



CPSC Recall List (Jul 2025)



Recall No.	Notifying Country	Product	Product Photo	Hazard / Risk	Remedy
25-372	USA	SNLN Party Supply Toys (Country of Origin: China)		<p>Ingestion Hazard</p> <p>SNLN Party Supply Toys Recalled Due to Ingestion Hazard; Risk of Serious Injury or Death; Federal Toy Standard Violation; Sold Exclusively on Amazon by Yiwu Dixikeji Douxiangongsi</p> <p>The recalled party supply toys violate the mandatory standard for toys containing button cell batteries because the compartment that holds the batteries can be easily accessed and opened by children, posing a deadly ingestion hazard to children.</p> <p>When button cell or coin batteries are swallowed, the ingested batteries can cause serious injuries, internal chemical burns and death.</p>	<p>Consumers should immediately stop using the recalled party supply toys and take them away from children. Contact Yiwu Dixikeji Douxiangongsi for a full refund. To receive a refund, consumers should send a photo of the recalled toys being disposed of in the trash by email at dixikeji@gmail.com. Yiwu Dixikeji Douxiangongsi and Amazon are contacting all known purchasers directly.</p> <p>Note: Button cell and coin batteries are hazardous. Batteries should be disposed of or recycled by following local hazardous waste procedures.</p>

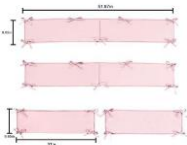

25-379	USA	Creeklilybear “Pack and Play” Aftermarket Play Yard Mattresses (Country of Origin: China)		Entrapment Hazard Creeklilybear Play Yard Mattresses Recalled Due to Risk of Serious Injury or Death from Entrapment Hazard; Violates Mandatory Standard for Crib Mattresses; Sold on Amazon by Kbabyea The aftermarket play yard mattresses violate the mandatory standard for crib mattresses as the mattresses exceed thickness requirements and may not adequately fit certain play yards, posing a deadly entrapment hazard. Babies can suffocate in gaps between an undersized mattress, or extra padding, and side walls of a product, especially when the infant’s face becomes trapped against the side and the mattress, preventing the infant from breathing.	Consumers should immediately stop using the mattresses and contact Kbabyea for a full refund. Consumers should cut the mattresses in half and send a photo of the cut-mattress in the waste bin to Kbabytearecall@outlook.com to receive a full refund.
25-380	USA	WLIVE Fabric 15-Drawer Dressers (Country of Origin: China)		Tip-Over and Entrapment Hazards WLIVE Fabric Dressers Recalled Due to Risk of Serious Injury or Death from Tip-Over and Entrapment Hazards; Violations of Federal Standard for Clothing Storage Units; Sold on Amazon by WLIVE The recalled dressers are unstable if they are not anchored to the wall, posing serious tip-over and entrapment hazards that can result in injuries or death to children. The dressers violate the federal standard as required by the STURDY Act.	Consumers should immediately stop using the recalled dressers if they are not anchored to a wall and place them in an area that children cannot access. Contact WLIVE for instructions on how to dispose of the dressers to receive a full refund. Consumers must submit a photo of the disposed dresser to wliveproductrecall@wlivehome.com . WLIVE and Amazon are contacting all known purchasers directly.



25-383	USA	Braided crib bumpers (Country of Origin: China)		Risk of Serious Injury or Death Braided Crib Bumpers Recalled Due to Risk of Serious Injury or Death from Suffocation; Violates Federal Crib Bumper Ban; Sold on Amazon by Haoyunm. The recalled crib bumpers violate the federal ban on crib bumpers because the padded crib bumpers can obstruct breathing, posing a risk of serious injury or death to infants from suffocation. Padded crib bumpers are banned by the Federal Safe Sleep for Babies Act. This recall involves braided crib bumpers. They are sold in multiple colors and have sizes in 39 inches, 59 inches, 78 inches, 118 inches and 158 inches long. They come in a vacuum sealed bag. There are no markings or labeling on the crib bumpers.	Consumers should stop using the crib bumpers, remove them from the crib immediately and contact Haoyunm for a refund. Consumers should cut the bumper in half, take a photo of it, and email the photo to hyzhongtshung@outlook.com .
--------	-----	---	---	--	--



25-384	USA	AUGNORYE Padded Cushioned Crib Bumpers (Country of Origin: China)		Risk of Suffocation AUGNORYE Padded Crib Bumpers Recalled Due to Risk of Serious Injury or Death from Suffocation; Violates Federal Crib Bumper Ban; Sold on Amazon by YIXIA. The recalled padded cushioned crib bumpers violate the federal crib bumper ban because they can obstruct an infant's breathing, posing a suffocation hazard. This creates an unsafe sleeping environment for infants. Padded crib bumpers are banned by the Safe Sleep for Babies Act. This recall involves AUGNORYE padded cushioned crib bumpers. The polyester pink bumpers were sold in four pieces and measure approximately 27 inches by 9.6 inches, and 52 inches by 9.6 inches. There is a care label with a series of letters and numbers stitched to the crib bumper.	Consumers should immediately stop using the recalled padded cushioned crib bumpers and contact YIXIA for a full refund. Consumers should remove the crib bumpers, cut the straps and padding and email a photo of the destroyed bumpers to Yixiakejirecall@163.com to obtain a full refund. YIXIA and Amazon are contacting all known purchasers directly.
--------	-----	---	---	---	---



25-385	USA	Dearlomum Retractable Safety Gates (Country of Origin: China)		Entrapment Hazard Dearlomum Retractable Safety Gates Recalled Due to Risk of Serious Injury or Death to Children from Entrapment Hazard; Violates Federal Standard for Gates and Enclosures; Sold on Amazon by Signbaby The recalled gates violate the federal standard for expansion gates and expandable enclosures because a child's torso can fit through the opening between the gate and the floor, posing a risk of serious injury or death due to entrapment hazard.	Consumers should stop using the recalled gates immediately and contact Signbaby for instructions to receive a full refund. Consumers will be asked to disassemble the gates and destroy them by cutting the mesh and to send a photo of the destroyed gates to regcards.team@gmail.com . Once the photo is received, Signbaby will issue a full refund. Signbaby and Amazon are contacting all known purchasers directly.
25-388	USA	Primark DTR (direct-to-retail) Stitch Scented Highlighters (4-pack) (Country of Origin: China)		Risk of Phthalate Exposure Primark Recalls DTR Stitch 4-pack Scented Highlighters Due to Risk of Phthalate Exposure; Violates Federal Phthalates Ban; Sold by Primark The scented highlighters, which resemble cups with straws, contain phthalates; a violation of the federal phthalates ban. Phthalates are toxic if ingested by young children and can cause adverse health effects.	Consumers should immediately stop using the recalled scented highlighters and return them to a Primark store for a full refund in the form of the original payment.

25-392	USA	Babyletto Kiwi Electronic Recliner and Swivel Gliders with USB port (Country of Origin: China)		Overheating Hazard Bexco Enterprises Recalls Kiwi Electronic Recliner and Swivel Gliders with USB Port Due to Overheating Hazard The USB module in the recliner arm can overheat and spark, posing an overheating hazard.	Consumers should immediately stop using the recalled recliners and contact Babyletto to receive a free repair kit. Consumers should register at babylettorecall.com/ to receive their free repair kit and installation instructions. Once consumers have completed the repair, consumers should dispose of the original USB module in their household trash.
25-397	USA	Georgia Pine Gum Spirits of Turpentine Bottles (Country of Origin: United States)		Risk of Serious Injury or Death Diamond G Forest Products Recalls Turpentine Bottles Due to Risk of Serious Injury or Death from Child Poisoning; Violates Mandatory Standard for Child Resistant Packaging The bottles contain turpentine, which must be in child-resistant packaging as required by the Poison Prevention Packaging Act. The packaging is not child-resistant, posing a risk of serious injury or death from poisoning if the contents are ingested by young children.	Consumers should immediately secure the recalled turpentine bottles out of the sight and reach of children and contact Diamond G Forest Products for information on how to obtain a free replacement child-resistant closure.

25-398	USA	LED Gloves (Country of Origin: China)		Missing of Warnings LED Gloves Recalled Due to Risk of Serious Injury or Death from Battery Ingestion; Violates the Mandatory Toy Standard and Child Resistant Coin Battery Packaging Standard; Sold on Amazon by Minongad The recalled LED gloves violate the mandatory standard for toys containing coin batteries because the compartment that holds the batteries can be easily accessed and opened by children. Additionally, the spare coin batteries provided with the toys are not in child-resistant packaging and do not have the warnings required under Reese's Law. When button cell or coin batteries are swallowed, the ingested batteries can cause serious injuries, internal chemical burns and death.	Consumers should immediately stop using the recalled LED gloves, take them away from children and dispose of them. Contact Minongad for a full refund. Note: Button cell and coin batteries are hazardous. Batteries should be disposed of or recycled by following local hazardous waste procedures.
25-399	USA	100% Natural Pure Gum Spirits of Turpentine Bottles (Country of Origin: United States)		Poisoning Hazard Creekwood Naturals Recalls 100% Natural Pure Gum Spirits of Turpentine Bottles Due to Risk of Serious Injury or Death from Child Poisoning; Violates Mandatory Standard for Child Resistant Packaging The recalled bottles contain turpentine, which must be in child-resistant packaging as required by the Poison Prevention Packaging Act. The turpentine bottles violate the mandatory standard for child-resistant packaging, posing a deadly poisoning hazard to young children.	Consumers should immediately secure the recalled turpentine bottles out of the sight and reach of children. Consumers should contact Creekwood Naturals for a free replacement child-resistant closure. Consumers must complete a form online at https://creekwoodnaturals.com/pages/recall to receive the replacement.

25-400	USA	Aiho Dressers (Country of Origin: China)		Tip-Over and Entrapment Hazards Aiho Dressers Recalled Due to Risk of Serious Injury or Death from Tip-Over and Entrapment; Violates Mandatory Standard; Sold on Walmart.com by Aiho The recalled dressers are unstable if they are not anchored to the wall, posing serious tip-over and entrapment hazards that can result in injuries or death to children. The dressers fail to meet the mandatory standard, as required by the STURDY Act.	Consumers should immediately stop using the recalled dressers if they are not anchored to a wall and place them in an area where children cannot access them. Contact Aiho for instructions on how to dispose of the dressers to receive a full refund. Consumers must submit a photo of the disposed dresser to support@aiholife.com.
25-401	USA	LIVACTI Retractable Safety Gates (Country of Origin: China)		Risk of Serious Injury or Death LIVACTI Retractable Safety Gates Recalled Due to Risk of Serious Injury or Death from Entrapment; Violates Mandatory Standard for Gates and Enclosures; Sold on Amazon by Qeyan and Yanyanny The recalled gates violate the mandatory standard for expansion gates and expandable enclosures because a child's torso can fit through the opening between the gate and the floor, posing a risk of serious injury or death due to entrapment.	Consumers should stop using the recalled gates immediately and contact Qeyan and Yanyanny for instructions on how to receive a full refund. Consumers must destroy the gate by cutting through the mesh and take a photo showing the destroyed gate. Submit the photo to support@livactihome.com.

25-404	USA	Minecraft Light-Up Slap Ruler Bracelets (Country of Origin: China)		Ingestion Hazard Innovative Designs Recalls Minecraft Light-Up Slap Ruler Bracelets Due to Risk of Serious Injury or Death from Button Cell Battery Ingestion Hazard; Violates Mandatory Standard for Toys The battery compartment of the recalled light-up ruler bracelets can be opened easily by children allowing access to the button cell batteries, violating the battery-operated toys requirements under the mandatory standard for toys. If a child swallows a button cell or coin battery, it can cause serious injuries, internal chemical burns or death.	Consumers should immediately stop using the recalled Minecraft Light-Up Ruler Bracelets and take them away from children. Contact Innovative Designs for information on disposal and for a full refund. Consumers will need to email a photograph of disposal to info@innovativenyc.com to receive the refund. Note: Button cell and coin batteries are hazardous. Batteries should be disposed of or recycled by following local hazardous waste procedures.
25-413	USA	Magnetic Floating Stackers toys (Country of Origin: Honduras)		Ingestion Hazard Tegu Recalls Magnetic Floating Stackers Toys Due to Magnet Ingestion Hazard; Risk of Serious Injury or Death; Violates Mandatory Standard for Toy Magnets The recalled magnetic floating stackers toys violate the mandatory standard for toy magnets because they contain magnets that can loosen and detach from the toy, posing an ingestion hazard to children. When high-powered magnets are swallowed, the ingested magnets can attract each other, or other metal objects, and become lodged in the digestive system. This can result in perforations, twisting, and/or blockage of the intestines, blood poisoning and death.	Consumers should take the product away from children immediately and contact Tegu for instructions on receiving a free replacement stacker toy.

25-415	USA	KidKraft Farm to Table Model Play Kitchen (Country of Origin: China)		Strangulation Hazard Backyard Kids Recalls KidKraft Farm to Table Play Kitchens Due to Strangulation Hazard; One Death Reported If young children are climbing on the counter or crawling through the opening at the back of the play kitchen, their clothing can get caught on the plastic or metal hooks meant to hold toy kitchen accessories such as play pots and pans, posing a strangulation hazard.	Consumers should immediately stop using the play kitchens, remove the original hooks, and contact Backyard Kids for free replacement hooks.
25-419	USA	Baby Loren Morning Dresses (Country of Origin: Peru)		Risk of Burn Injuries and Death Baby Loren Recalls Morning Children's Loungewear Due to Serious Risk of Injury or Death from Burns; Violation of Federal Flammability Standards for Children's Sleepwear The recalled children's loungewear violates the flammability standards for children's sleepwear, posing a risk of burn injuries and death to children. This recall involves four different styles of Baby Loren Morning children's 100% cotton loungewear dresses. The loungewear was sold in floral tulips, princess and castle and unicorn and butterfly prints and in sizes 2T, 3T, 4T, 5Y and 6Y. The Baby Loren logo, the size, "October 2022" or "October 2023" and a batch number ending in 3465, 3585, 3599 or 3569 are printed on sewn-in neck labels.	Consumers should stop using the recalled dresses immediately and contact Baby Loren for information on how to return the recalled dresses free of cost for a full refund. Baby Loren is contacting all known purchasers directly.

* Source: www.recalls.gov


CPSC



The United States Consumer Product Safety Commission (CPSC) is an independent agency of the United States Government. To provide better service in alerting the American people to unsafe, hazardous or defective products, a “one stop shop” for U.S. Government recalls, <http://www.recalls.gov>, has been created. Members of the public may report unsafe products to CPSC by using the platform.

The recall list is divided into seven categories: Consumer Products, Motor Vehicles, Boats, Food, Medicine, Cosmetics and Environmental Products. Generally, the recall is conducted voluntarily by the company under CPSC’s Fast Track Recall programme. Fast Track recalls are initiated by firms who are committed to working with CPSC to quickly announce the recall and remedy to protect consumers.

Recall Summary – Australian Toys / Children’s Products

ACCC Recall List (Jul 2025)

PRA No.	Notifying Country	Product / Description	Product Photo	Hazard / Risk	Remedy
2025/20572	Australia	Infant Feeding Pillow (Country of Origin: China)		Risk of Serious Injury or Death Baby bottle self-feeding devices pose a possible risk to babies from choking, aspiration pneumonia, suffocation and ear infections. These products are subject to a safety warning notice. Risk of serious injury or death from choking, aspiration pneumonia, suffocation and ear infections. There have been reports of infant fatalities associated with the use of baby bottle self-feeding devices.	Stop using this product immediately and dispose of it safely so it can't be used by anyone else. Contact www.ezoneddeal.com.au for a refund or store credit or if you have sold or gifted it to another person. Contact Ezoneddeal Email: contactus@ezoneddeal.com.au Call: (03) 7065 6422 between 10:00 am to 3:00 pm Monday to Friday

2025/20577	Australia	Velour sleeveless sleepbag (Country of Origin: China)		Risk of Serious Injury or Death The shoulder snap can detach during use and come off. Risk of serious injury or death from choking if a child swallows the shoulder snap small part.	Stop using the product immediately. Return the product to your nearest Best&Less store for a full refund. Contact Best&Less Email: customerservice@bestandless.com.au Call: 1300 135 766 between 9:00am and 8:00pm AEST, Monday to Friday, 9:00am and 6:00pm (AEST) Saturday and Sunday (excluding public holidays)
2025/20510	Australia	Light Up Spaghetti Ball (Country of Origin: China)		Risk of Choking During play the ball can break and release the light-up module, creating small parts. There is a risk of choking if young children gain access to a small part and put it in their mouth.	Stop using the product immediately and place out of reach of children. Return the product to the point of purchase to obtain a refund. Contact IsAlbi Email: enquiries@isalbi.com.au Call: 1800 819 270. Hours: 9:00am to 5:00pm Monday to Friday

2025/20581	Australia	Children's glass tumblers (Country of Origin: Germany)		Risk of injuries from lacerations The glass may break if pressure is applied to the inside of the tumbler. Risk of injuries from lacerations if the glass breaks.	Stop using the product immediately. Fill out the form on the Villeroy & Boch website to arrange a free return postage label and send the tumblers back to Villeroy & Boch. Villeroy & Boch will provide a full refund even without a receipt.
2025/20590	Australia	LED Butterfly Wand (Country of Origin: China)		Risk of Choking, Serious injury or Death This product does not comply with the mandatory standards for products containing button/coin batteries. The battery compartment is not secure. Risk of choking, serious injury or death to young children if they gain access to the button/coin batteries and swallow or place them inside their body. Consumers may be unaware the product contains a button battery.	Consumers should immediately stop using the product and keep it away from children. Contact info@electricwonderland.com.au for information on how to receive a full refund and information on safe disposal. Contact Electric Wonderland Email: info@electricwonderland.com.au Visit: www.electricwonderland.com.au/productrecall

Australian Product Safety System

The Australian product safety system is set up to maximise the safety of goods through the cooperation of consumers, businesses and agencies. This policy sets out the principles adopted by the Australian Competition and Consumer Commission (ACCC) for prioritising and addressing product safety risks.

Under the Australian Consumer Law, a responsible Minister can order a compulsory recall when there are hazards on the products. A voluntary recall could be conducted to remove the product from the marketplace when the suppliers become aware of unsafe or defective products.

The ACCC administers a national recalls system for recalls of specific and general consumer products, and publishes all product recalls on <https://www.productsafety.gov.au/recalls>.

STC (Hong Kong Standards and Testing Centre) is a not-for-profit, independent testing, inspection and certification organization. With a global network of ISO/IEC 17025 accredited testing laboratories and over 60 years of experience in consumer product testing, we can meet your conformity assessment needs with highly efficient and reliable service. Our testing scope and capabilities related to toys and children's products include but are not limited to:

EU Requirements

- EN 71
- Phthalates (EC) no. 1907/2006
- Nickel Release (EC) no. 1907/2006
- Total Cadmium (EEC) no. 91/338
- Lead in Jewellery product (EC) no. 836/2012
- Azo-dye (EC) no. 1907/2006
- Bisphenol-A (2014/81/EU)
- DMF (Dimethyl fumarate) (EU) no. 2011/135
- Flame retardants TCEP, TCPP, TDCP (2014/79/EU)
- Package Waste Directive (94/62/EC)

US & Canada Requirements

- ASTM F963
- CPSIA
- California Proposition 65
- 16 CFR 1501
- ASTM F2923 (Children's jewellery)
- ASTM F2999 (Adult's jewellery)
- US Toxic in Packaging Clearinghouse (TPCH)
- CCPSA - Toys Regulations (SOR/2011-17)

Japan Requirements

- Japan Toy Safety Standard (ST)
- Japan Food Sanitation Law (JFSL)

Australia Requirements

- AS/NZS 8124
- Consumer Protection Notice No. 6 of 2010 - DEHP

FOR MORE DETAILS, PLEASE CONTACT US:

Hong Kong: hktcd@stc.group
Changzhou: czstc@stc.group
U.S.A.: usenquiry@stc.group

Guangdong: gdtcd@stc.group
Vietnam: vnstc@stc.group
Germany: grstc@stc.group

Shanghai: shtcd@stc.group
Japan: jpo@stc.group

